



**US Army Corps
of Engineers®**

Flood Damage Reduction Segment / System Inspection Report

Name of Segment / System: Little Cal - Munster

Public Sponsor(s): Little Calumet River Basin Development Commission

Public Sponsor Representative: Dan Repay (LCRBDC)

Sponsor Phone: 219-595-0599

Sponsor Email: drepay@littlecalumetriverbasin.org

Corps of Engineers Inspector: See attached sign-in sheet and inspection team list

Inspection Start Date: 4/29/2014

Inspection End Date: 4/29/2014

Inspection Report Prepared By: Yuki J. Galisanao, P.E.; John Wethington

Date Report Prepared: 5/22/2014

Internal Technical Review (for Periodic Inspections) By: William A. Rochford, P.E., LSPM

Date of ITR: 6/27/2014

Final Approved By: Joseph Schmidt, PE, LSO

Joseph Schmidt

Date Approved: 11 Aug 14

Type of Inspection:	<input type="checkbox"/> Initial Eligibility Inspection <input checked="" type="checkbox"/> Continuing Eligibility Inspection (Routine) <input type="checkbox"/> Continuing Eligibility Inspection (Periodic)	Overall Segment / System Rating: <input type="checkbox"/> Acceptable <input checked="" type="checkbox"/> Minimally Acceptable <input type="checkbox"/> Unacceptable
Contents of Report:	<input checked="" type="checkbox"/> Instructions <input type="checkbox"/> Initial Eligibility Inspection <input checked="" type="checkbox"/> General Items for All Flood Control Works <input checked="" type="checkbox"/> Levee Embankment <input checked="" type="checkbox"/> Concrete Floodwalls <input type="checkbox"/> Sheet Pile and Concrete I-walls <input checked="" type="checkbox"/> Interior Drainage System <input checked="" type="checkbox"/> Pump Stations <input type="checkbox"/> FDR System Channels	<p>Note: In addition to the report contents indicated here, a plan view drawing of the system, with stationing, should be included with this report to reference locations of items rated less than acceptable. Photos of general system condition and any noted deficiencies should also be attached.</p> <p>Note: This inspection rating represents the Corps evaluation of operations and maintenance of the flood damage reduction system and may be used in conjunction with other information for a levee certification determination for National Flood Insurance Program (NFIP) purposes if applicable. An Acceptable Corps inspection rating, alone, does not equate to a certifiable levee for the NFIP. It is recommended for levee systems currently accredited by the Federal Emergency Management Agency (FEMA) for NFIP purposes receiving a Corps Minimally Acceptable or Unacceptable rating, be evaluated by the levee owner to determine the potential impacts to the certification for FEMA.</p>

General Instructions for the Inspection of Flood Damage Reduction Segments / Systems

A. Purpose of USACE Inspections:

The primary purpose of these inspections is to prevent loss of life and catastrophic damages; preserve the value of Federal investments, and to encourage non-Federal sponsors to bear responsibility for their own protection. Inspections should assure that Flood Damage Reduction structures and facilities are continually maintained and operated as necessary to obtain the maximum benefits. Inspections are also conducted to determine eligibility for Rehabilitation Assistance under authority of PL 84-99 for Federal and non-Federal systems. (ER 1130-2-530, ER 500-1-1)

B. Types of Inspections:

The Corps conducts several types of inspections of Flood Damage Reduction systems, as outlined below:

Initial Eligibility Inspections	Continuing Eligibility Inspections	
	Routine Inspections	Periodic Inspections
IEIs are conducted to determine whether a non-Federally constructed Flood Damage Reduction system meets the minimum criteria and standards set forth by the Corps for initial inclusion into the Rehabilitation and Inspection Program.	RIs are intended to verify proper maintenance, owner preparedness, and component operation.	PIs are intended to verify proper maintenance and component operation and to evaluate operational adequacy, structural stability, and safety of the system. Periodic Inspections evaluate the system's original design criteria vs. current design criteria to determine potential performance impacts, evaluate the current conditions, and compare the design loads and design analysis used against current design standards. This is to be done to identify components and features for the sponsor that need to be monitored more closely over time or corrected as needed. (Periodic Inspections are used as the basis of risk assessments.)

C. Inspection Boundaries:

Inspections should be conducted so as to rate each Flood Damage Reduction "Segment" of the system. The overall system rating will be the lowest segment rating in the system.

Project	System	Segment
A flood damage reduction project is made up of one or more flood damage reduction systems which were under the same authorization.	A flood damage reduction system is made up of one or more flood damage reduction segments which collectively provide flood damage reduction to a defined area. Failure of one segment within a system constitutes failure of the entire system. Failure of one system does not affect another system.	A flood damage reduction segment is defined as a discrete portion of a flood damage reduction system that is operated and maintained by a single entity. A flood damage reduction segment can be made up of one or more features (levee, floodwall, pump stations, etc).

D. Land Use Definitions:

The following three definitions are intended for use in determining minimum required inspection intervals and initial requirements for inclusion into the Rehabilitation and Inspection Program. Inspections should be considered for all systems that would result in significant environmental or economic impact upon failure regardless of specific land use.

Agricultural	Rural	Urban
Protected population in the range of zero to 5 households per square mile protected.	Protected population in the range of 6 to 20 households per square mile protected.	Greater than 20 households per square mile; major industrial areas with significant infrastructure investment. Some protected urban areas have no permanent population but may be industrial areas with high value infrastructure with no overnight population.



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

General Instructions
Page 1 of 3

E. Use of the Inspection Report Template:

The report template is intended for use in all Army Corps of Engineers inspections of levee and floodwall systems and flood damage reduction channels. The section of the template labeled "Initial Eligibility" only needs to be completed during Initial Eligibility Inspections of Non-Federally constructed Flood Damage Reduction Systems. The section labeled "General Items" needs to be completed with every inspection, along with all other sections that correspond to features in the system. The section labeled "Public Sponsor Pre-Inspection Report" is intended for completion before the inspection, if possible.

F. Individual Item / Component Ratings:

Assessment of individual components rated during the inspection should be based on the criteria provided in the inspection report template, though inspectors may incorporate additional items into the report based on the characteristics of the system. The assessment of individual components should be based on the following definitions.

Acceptable Item	Minimally Acceptable Item	Unacceptable Item
The inspected item is in satisfactory condition, with no deficiencies, and will function as intended during the next flood event.	The inspected item has one or more minor deficiencies that need to be corrected. The minor deficiency or deficiencies will not seriously impair the functioning of the item as intended during the next flood event.	The inspected item has one or more serious deficiencies that need to be corrected. The serious deficiency or deficiencies will seriously impair the functioning of the item as intended during the next flood event.

G. Overall Segment / System Ratings:

Determination of the overall system rating is based on the definitions below. Note that an Unacceptable System Rating may be either based on an engineering determination that concluded that noted deficiencies would prevent the system from functioning as intended during the next flood event, or based on the sponsor's demonstrated lack of commitment or inability to correct serious deficiencies in a timely manner.

Acceptable System	Minimally Acceptable System	Unacceptable System
All items or components are rated as Acceptable.	One or more items are rated as Minimally Acceptable or one or more items are rated as Unacceptable and an engineering determination concludes that the Unacceptable items would not prevent the segment / system from performing as intended during the next flood event.	One or more items are rated as Unacceptable and would prevent the segment / system from performing as intended, or a serious deficiency noted in past inspections (which had previously resulted in a minimally acceptable system rating) has not been corrected within the established timeframe, not to exceed two years.

H. Eligibility for PL84-99 Rehabilitation Assistance:

Inspected systems that are not operated and maintained by the Federal government may be Active in the Corps' Rehabilitation and Inspection Program (RIP) and eligible for rehabilitation assistance from the Corps as defined below:

If the Overall System Rating is Acceptable	If the Overall System Rating is Minimally Acceptable	If the Overall System Rating is Unacceptable
The system is active in the RIP and eligible for PL84-99 rehabilitation assistance.	The system is Active in the RIP during the time that it takes to make needed corrections. Active systems are eligible for rehabilitation assistance. However, if the sponsor does not present USACE with proof that serious deficiencies (which had previously resulted in a minimally acceptable system rating) were corrected within the established timeframe, then the system will become Inactive in the RIP.	The system is Inactive in the RIP, and the status will remain Inactive until the sponsor presents USACE with proof that all items rated Unacceptable have been corrected. Inactive systems are ineligible for rehabilitation assistance.

I. Reporting:

After the inspection, the Corps is responsible for assembling an inspection report (or a summary report if it was a Periodic Inspection) including the following information:

- a. All sections of the report template used during the inspection, including the cover and pre-inspection materials. (Supplemental data collected, and any sections of the template that weren't used during the inspection do not need to be included with the report.)
- b. Photos of the general system condition and noted deficiencies.
- c. A plan view drawing of the system, with stationing, to reference locations of items rated less than acceptable.
- d. The relative importance of the identified maintenance issues should be specified in the transmittal letter.
- e. If the Overall System Rating is Minimally Acceptable, the report needs to establish a timeframe for correction of serious deficiencies noted (not to exceed two years) and indicate that if these items are not corrected within the required timeframe, the system will be rated as Unacceptable and made Inactive in the Rehabilitation Inspection Program.

J. Notification:

Reports are to be disseminated as follows within 30 days of the inspection date.

If the Overall System Rating is Acceptable	If the Overall System Rating is Minimally Acceptable	If the Overall System Rating is Unacceptable
Reports need to be provided to the local sponsor and the county emergency management agency.	Reports need to be provided to the local sponsor, state emergency management agency, county emergency management agency, and to the FEMA region.	Reports need to be provided to the local sponsor, state emergency management agency, county emergency management agency, FEMA region, and to the Congressional delegation within 30 days of the inspection.





**US Army Corps
of Engineers®**

Flood Damage Reduction System Public Sponsor Pre-Inspection Report

The following information is to be provided by the levee district sponsor prior to an inspection. This information will be used to help evaluate the organizational capability of the levee district to manage the levee system maintenance program.

1. Levee system and district: (name of the system and levee district) Little Calumet River – Munster Levee
2. Reporting period: (month/day/year to month/day/year) Sept 2013 - April 2014
3. Summary of maintenance required by last inspection report:
4. Summary of maintenance performed this reporting period: Cutting grass, clear gates of silt and other debris
5. Summary of maintenance planned next reporting period: Columbia Bridge Rehab completed, Pedestrian Bridge in progress
6. Summary of changes to system since last inspection:
7. Problems/ issues requiring the assistance of the US Army Corps of Engineers:

Public Sponsor Pre-Inspection Report

The following information is to be provided by the levee district sponsor prior to an inspection

8. Levee district organization: (elected or appointed levee district officials and key employees)				
Name	Position	Mailing Address	Phone Number	Email Address

Public Sponsor Representative		
Name	Organization	Team
Dan Repay	LCRBDC	Levee
Ricky Wilcox	Hammond Sanitary District	Pump Stations
Sam Grant	Hammond Sanitary District	Pump Stations
Mark Knesek	Town of Munster	Sluice Gates

Corps of Engineer Inspection Team		
Name	Role	Team
Bill Rochford	Levee Safety Program Manager	Levee
Yuki Galisanao	Lead / Geotechnical	Levee
Andy Wadysz	Structural	Levee
Arun Heer	Hydraulics	Levee
John Wethington	GIS	Levee
Robert Sezonov	Mechanical	Pump Stations
Ernie Go	Electrical	Pump Stations
Laura Vanden Berg	Civil	Sluice Gates
Arthur Rundzaitis	Construction	Sluice Gates

General Items for All Flood Damage Reduction Segments / Systems

For use during all inspections of all Flood Damage Reduction Segments / Systems

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
1. Operations and Maintenance Manuals	A	A	Levee Owner's Manual, O&M Manuals, and/or manufacturer's operating instructions are present.	Documents maintained by the Munster Public Works Department and relevant copies distributed to appropriate internal agencies.
		M	Sponsor manuals are lost or missing or out of date; however, sponsor will obtain manuals prior to next scheduled inspection.	
		U	Sponsor has not obtained lost or missing manuals identified during previous inspection.	
2. Emergency Supplies and Equipment (A or M only)	A	A	The sponsor maintains a stockpile of sandbags, shovels, and other flood fight supplies which will adequately supply all needs for the initial days of a flood fight. Sponsor determines required quantity of supplies after consulting with inspector.	Town of Munster has ready inventory of flood fighting supplies and equipment (over 5000 filled sandbags, over 100k empty sandbags, 20 superbags and adequate supplies of equipment. Primary resources available through public works department, but also can be supplemented by other city departments.
		M	The sponsor does not maintain an adequate supply of flood fighting materials as part of their preparedness activities.	
3. Flood Preparedness and Training (A or M only)	M	A	Sponsor has a written system-specific flood response plan and a solid understanding of how to operate, maintain, and staff the FDR system during a flood. Sponsor maintains a list of emergency contact information for appropriate personnel and other emergency response agencies.	Munster supports a reverse 911 and other emergency response services. The levee system Flood Warning Handbook is dated 2010 and recommended to be updated. Specifically, some reference river gages are no longer operational and contact information is out-of-date. Response action levels should be referenced to existing USGS River Gages at Hohman Ave and Hart Ditch.
		M	The sponsor maintains a good working knowledge of flood response activities, but documentation of system-specific emergency procedures and emergency contact personnel is insufficient or out of date.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

General Items for All Flood Damage Reduction
Segments / Systems
Page 1 of 1

Levee Embankments

For use during Initial and Continuing Eligibility Inspections of levee segments / systems

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
1. Unwanted Vegetation Growth ¹	M	A	The levee has little or no unwanted vegetation (trees, bush, or undesirable weeds), except for vegetation that is properly contained and/or situated on overbuilt sections, such that the mandatory 3-foot root-free zone is preserved around the levee profile. The levee has been recently mowed. The vegetation-free zone extends 15 feet from both the landside and riverside toes of the levee to the centerline of the tree. If the levee access easement doesn't extend to the described limits, then the vegetation-free zone must be maintained to the easement limits. Reference EM 1110-2-301 or Corps policy for regional vegetation variance.	LCMN_2014_a_0010: Station_1 NA: 2 trees on landside: These are dying and are recommended to be removed. (M)
		M	Minimal vegetation growth (brush, weeds, or trees 2 inches in diameter or smaller) is present within the zones described above. This vegetation must be removed but does not currently threaten the operation or integrity of the levee.	
		U	Significant vegetation growth (brush, weeds, or any trees greater than 2 inches in diameter) is present within the zones described above and must to be removed to reestablish or ascertain levee integrity.	
2. Sod Cover	M	A	There is good coverage of sod over the levee.	LCMN_2014_a_0062: Station_1 NA: Rutting due to temporary construction: Check that the levee is restored once construction is complete (M) LCMN_2014_a_0064: Station_1 NA: Poor sod cover: Seed (M) LCMN_2014_a_0065: Station_1 NA: Poor sod: Seed (M)
		M	Approximately 25% of the sod cover is missing or damaged over a significant portion or over significant portions of the levee embankment. This may be the result of over-grazing or feeding on the levee, unauthorized vehicular traffic, chemical or insect problems, or burning during inappropriate seasons.	
		U	Over 50% of the sod cover is missing or damaged over a significant portion or portions of the levee embankment.	
		N/A	Surface protection is provided by other means.	
3. Encroachments	M	A	No trash, debris, unauthorized farming activity, structures, excavations, or other obstructions present within the easement area. Encroachments have been previously reviewed by the Corps, and it was determined that they do not diminish proper functioning of the levee.	LCMN_2014_a_0046: Station_1 NA: Station_2 NA: Gardens and items on landside toe: Talk to resident to request action or submit permit request (M) LCMN_2014_a_0049: Station_1 NA: Fence near landside toe: Remove within 15 ft of the levee or request permit (M)
		M	Trash, debris, unauthorized farming activity, structures, excavations, or other obstructions present, or inappropriate activities noted that should be corrected but will not inhibit operations and maintenance or emergency operations. Encroachments have not been reviewed by the Corps.	
		U	Unauthorized encroachments or inappropriate activities noted are likely to inhibit operations and maintenance, emergency operations, or negatively impact the integrity of the levee.	
4. Closure Structures (Stop Log, Earthen Closures, Gates, or Sandbag)	A	A	Closure structure in good repair. Placing equipment, stoplogs, and other materials are readily available at all times. Components are clearly marked and installation instructions/ procedures readily available. Trial erections have been accomplished in accordance with the O&M Manual.	River Road closure exercise being scheduled for this summer Material readily available.

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Levee Embankments
Page 1 of 10

Levee Embankments

For use during Initial and Continuing Eligibility Inspections of levee segments / systems

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
Closures) (A or U only)		U	Any of the following issues is cause for this rating: Closure structure in poor condition. Parts missing or corroded. Placing equipment may not be available within the anticipated warning time. The storage vaults cannot be opened during the time of inspection. Components of closure are not clearly marked and installation instructions/ procedures are not readily available. Trial erections have not been accomplished in accordance with the O&M Manual.	
		N/A	There are no closure structures along this component of the FDR segment / system.	
5. Slope Stability	A	A	No slides, sloughs, tension cracking, slope depressions, or bulges are present.	
		M	Minor slope stability problems that do not pose an immediate threat to the levee embankment.	
		U	Major slope stability problems (ex. deep seated sliding) identified that must be repaired to reestablish the integrity of the levee embankment.	
6. Erosion/ Bank Caving	A	A	No erosion or bank caving is observed on the landward or riverward sides of the levee that might endanger its stability.	
		M	There are areas where minor erosion is occurring or has occurred on or near the levee embankment, but levee integrity is not threatened.	
		U	Erosion or caving is occurring or has occurred that threatens the stability and integrity of the levee. The erosion or caving has progressed into the levee section or into the extended footprint of the levee foundation and has compromised the levee foundation stability.	
7. Settlement ²	A	A	No observed depressions in crown. Records exist and indicate no unexplained historical changes.	
		M	Minor irregularities that do not threaten integrity of levee. Records are incomplete or inclusive.	
		U	Obvious variations in elevation over significant reaches. No records exist or records indicate that design elevation is compromised.	
8. Depressions/ Rutting	M	A	There are scattered, shallow ruts, pot holes, or other depressions on the levee that are unrelated to levee settlement. The levee crown, embankments, and access road crowns are well established and drain properly without any ponded water.	LCMN_2014_a_0047: Station_1 NA: Rutting on landside slope: Fill (A) LCMN_2014_a_0054: Station_1 NA: Rutting on riverside slope: Fill (A) LCMN_2014_a_0061: Station_1 NA: Rut on riverside with ponded water: Fill (M)
		M	There are some infrequent minor depressions less than 6 inches deep in the levee crown, embankment, or access roads that will pond water.	
		U	There are depressions greater than 6 inches deep that will pond water.	
9. Cracking	A	A	Minor longitudinal, transverse, or desiccation cracks with no vertical movement along the crack. No cracks extend continuously through the levee crest.	
		M	Longitudinal and/or transverse cracks up to 6 inches in depth with no vertical movement along the crack. No cracks extend continuously through the levee crest. Longitudinal cracks are no longer than the height of the levee.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Levee Embankments
Page 2 of 10

Levee Embankments

For use during Initial and Continuing Eligibility Inspections of levee segments / systems

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
		U	Cracks exceed 6 inches in depth. Longitudinal cracks are longer than the height of the levee and/or exhibit vertical movement along the crack. Transverse cracks extend through the entire levee width.	
10. Animal Control	M	A	Continuous animal burrow control program in place that includes the elimination of active burrowing and the filling in of existing burrows.	LCMN_2014_a_0050: Station_1 NA: 1 ft deep burrow on riverside: Fill (M)
		M	The existing animal burrow control program needs to be improved. Several burrows are present which may lead to seepage or slope stability problems, and they require immediate attention.	
		U	Animal burrow control program is not effective or is nonexistent. Significant maintenance is required to fill existing burrows, and the levee will not provide reliable flood protection until this maintenance is complete.	
11. Culverts/ Discharge Pipes ³ (This item includes both concrete and corrugated metal pipes.)	A	A	There are no breaks, holes, cracks in the discharge pipes/ culverts that would result in significant water leakage. The pipe shape is still essentially circular. All joints appear to be closed and the soil tight. Corrugated metal pipes, if present, are in good condition with 100% of the original coating still in place (either asphalt or galvanizing) or have been relined with appropriate material, which is still in good condition. Condition of pipes has been verified using television camera video taping or visual inspection methods within the past five years, and the report for every pipe is available for review by the inspector.	Culvert inspection performed in 2012. Inspection results were reviewed and no issues were identified. Next inspection should be performed in 2017.
		M	There are a small number of corrosion pinholes or cracks that could leak water and need to be repaired, but the entire length of pipe is still structurally sound and is not in danger of collapsing. Pipe shape may be ovalized in some locations but does not appear to be approaching a curvature reversal. A limited number of joints may have opened and soil loss may be beginning. Any open joints should be repaired prior to the next inspection. Corrugated metal pipes, if present, may be showing corrosion and pinholes but there are no areas with total section loss. Condition of pipes has been verified using television camera video taping or visual inspection methods within the past five years, and the report for every pipe is available for review by the inspector.	
		U	Culvert has deterioration and/or has significant leakage; it is in danger of collapsing or as already begun to collapse. Corrugated metal pipes have suffered 100% section loss in the invert. HOWEVER: Even if pipes appear to be in good condition, as judged by an external visual inspection, an Unacceptable Rating will be assigned if the condition of pipes has not been verified using television camera video taping or visual inspection methods within the past five years, and reports for all pipes are not available for review by the inspector.	
		N/A	There are no discharge pipes/ culverts.	
12. Riprap Revetments &	A	A	No riprap displacement or stone degradation that could pose an immediate threat to the integrity of channel bank. Riprap intact with no woody vegetation present.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Levee Embankments
Page 3 of 10

Levee Embankments

For use during Initial and Continuing Eligibility Inspections of levee segments / systems

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
Bank Protection		M	Minor riprap displacement or stone degradation that could pose an immediate threat to the integrity of the channel bank. Unwanted vegetation must be cleared or sprayed with an appropriate herbicide.	
		U	Significant riprap displacement, exposure of bedding, or stone degradation observed. Scour activity is undercutting banks, eroding embankments, or impairing channel flows by causing turbulence or shoaling. Rock protection is hidden by dense brush, trees, or grasses.	
		N/A	There is no riprap protecting this feature of the segment / system, or riprap is discussed in another section.	
13. Revetments other than Riprap	NA	A	Existing revetment protection is properly maintained, undamaged, and clearly visible.	
		M	Minor revetment displacement or deterioration that does not pose an immediate threat to the integrity of the levee. Unwanted vegetation must be cleared or sprayed with an appropriate herbicide.	
		U	Significant revetment displacement, deterioration, or exposure of bedding observed. Scour activity is undercutting banks, eroding embankments, or impairing channel flows by causing turbulence or shoaling. Revetment protection is hidden by dense brush and trees.	
		N/A	There are no such revetments protecting this feature of the segment / system.	
14. Underseepage Relief Wells/ Toe Drainage Systems	NA	A	Toe drainage systems and pressure relief wells necessary for maintaining FDR segment / system stability during high water functioned properly during the last flood event and no sediment is observed in horizontal system (if applicable). Nothing is observed which would indicate that the drainage systems won't function properly during the next flood, and maintenance records indicate regular cleaning. Wells have been pumped tested within the past 5 years and documentation is provided.	
		M	Toe drainage systems or pressure relief wells are damaged and may become clogged if they are not repaired. Maintenance records are incomplete or indicate irregular cleaning and pump testing.	
		U	Toe drainage systems or pressure relief wells necessary for maintaining FDR segment / system stability during flood events have fallen into disrepair or have become clogged. No maintenance records. No documentation of the required pump testing.	
		N/A	There are no relief wells/ toe drainage systems along this component of the FDR segment / system.	
15. Seepage	A	A	No evidence or history of unrepaired seepage, saturated areas, or boils.	
		M	Evidence or history of minor unrepaired seepage or small saturated areas at or beyond the landside toe but not on the landward slope of levee. No evidence of soil transport.	
		U	Evidence or history of active seepage, extensive saturated areas, or boils.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Levee Embankments
Page 4 of 10

Levee Embankments

For use during Initial and Continuing Eligibility Inspections of levee segments / systems

¹ If there is significant growth on the levee that inhibits the inspection of animal burrows or other items, the inspection should be ended until this item is corrected.

² Detailed survey elevations are normally required during Periodic Inspections, and whenever there are obvious visual settlements.

³ The decision on whether or not USACE inspectors should enter a pipe to perform a detailed inspection must be made at the USACE District level. This decision should be made in conjunction with the District Safety Office, as pipes may be considered confined spaces. This decision should consider the age of the pipe, the diameter of the pipe, the apparent condition of the pipe, and the length of the pipe. If a pipe is entered for the purposes of inspection, the inspector should record observations with a video camera in order that the condition of the entire pipe, including all joints, can later be assessed. Additionally, the video record provides a baseline to which future inspections can be compared.

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Levee Embankments
Page 5 of 10

Levee Embankments

For use during Initial and Continuing Eligibility Inspections of levee segments / systems



Inspect ID: LCMN_2014_a_0010 **Title:** USACE_CELRC_LCMN_2014_a_0010_1.jpg
Rated Item: 1. Unwanted Vegetation Growth **Caption:** Rating: Minimally Acceptable;
Remarks: 2 trees on landside; **Action:** These are dying and are recommended to be removed.



Inspect ID: LCMN_2014_a_0062 **Title:** USACE_CELRC_LCMN_2014_a_0062_1.jpg
Rated Item: 2. Sod Cover **Caption:** Rating: Minimally Acceptable; **Remarks:** Rutting due to temporary construction; **Action:** Check that the levee is restored once construction is complete



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Levee Embankments
Page 6 of 10

Levee Embankments

For use during Initial and Continuing Eligibility Inspections of levee segments / systems



Inspect ID: LCMN_2014_a_0064 **Title:** USACE_CELRC_LCMN_2014_a_0064_1.jpg
Rated Item: 2. Sod Cover **Caption:** Rating: Minimally Acceptable; Remarks: Poor sod cover; Action: Seed



Inspect ID: LCMN_2014_a_0065 **Title:** USACE_CELRC_LCMN_2014_a_0065_1.jpg
Rated Item: 2. Sod Cover **Caption:** Rating: Minimally Acceptable; Remarks: Poor sod; Action: Seed



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Levee Embankments
Page 7 of 10

Levee Embankments

For use during Initial and Continuing Eligibility Inspections of levee segments / systems



Inspect ID: LCMN_2014_a_0046 **Title:** USACE_CELRC_LCMN_2014_a_0046_1.jpg
Rated Item: 3. Encroachments **Caption:** Rating: Minimally Acceptable; Remarks: Gardens and items on landside toe; Action: Talk to resident to request action or submit permit request



Inspect ID: LCMN_2014_a_0049 **Title:** USACE_CELRC_LCMN_2014_a_0049_1.jpg
Rated Item: 3. Encroachments **Caption:** Rating: Minimally Acceptable; Remarks: Fence near landside toe; Action: Remove within 15 ft of the levee or request permit



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Levee Embankments
Page 8 of 10

Levee Embankments

For use during Initial and Continuing Eligibility Inspections of levee segments / systems

	<p>Inspect ID: LCMN_2014_a_0047 Title: USACE_CELRC_LCMN_2014_a_0047_1.jpg Rated Item: 8. Depressions/ Rutting Caption: Rating: Acceptable; Remarks: Rutting on landside slope; Action: Fill</p>
	<p>Inspect ID: LCMN_2014_a_0054 Title: USACE_CELRC_LCMN_2014_a_0054_1.jpg Rated Item: 8. Depressions/ Rutting Caption: Rating: Acceptable; Remarks: Rutting on riverside slope; Action: Fill</p>



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Levee Embankments
Page 9 of 10

Levee Embankments

For use during Initial and Continuing Eligibility Inspections of levee segments / systems

	<p>Inspect ID: LCMN_2014_a_0061 Title: USACE_CELRC_LCMN_2014_a_0061_1.jpg Rated Item: 8. Depressions/ Rutting Caption: Rating: Minimally Acceptable; Remarks: Rut on riverside with ponded water; Action: Fill</p>
	<p>Inspect ID: LCMN_2014_a_0050 Title: USACE_CELRC_LCMN_2014_a_0050_1.jpg Rated Item: 10. Animal Control Caption: Rating: Minimally Acceptable; Remarks: 1 ft deep burrow on riverside; Action: Fill</p>



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Levee Embankments
Page 10 of 10

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
1. Unwanted Vegetation Growth ¹	M	A	A grass-only or paved zone is maintained on both sides of the floodwall, free of all trees, brush, and undesirable weeds. The vegetation-free zone extends 15 feet from both the land and riverside of the floodwall, at ground-level, to the centerline of the tree. Additionally, an 8-foot root-free zone is maintained around the entire structure, including the floodwall toe, heel, and any toe-drains. If the floodwall access easement doesn't extend to the described limits, then the vegetation-free zone must be maintained to the easement limits. Reference EM 1110-2-301 and/or Corps policy for regional vegetation variance.	LCMN_2014_a_0003: Station_1 NA: Small trees along floodwall: Clear (M) LCMN_2014_a_0016: Station_1 NA: Trees on riverside of floodwall at Northcote: Clear (M) LCMN_2014_a_0020: Station_1 NA: Bush on riverside: Clear (M) LCMN_2014_a_0021: Station_1 NA: Station_2 NA: Tall brush on riverside: Clear (M)
		M	Minimal vegetation growth (brush, weeds, or trees 2 inches in diameter or smaller) is present within the zones described above. This vegetation must be removed but does not currently threaten the operation or integrity of the floodwall.	LCMN_2014_a_0023: Station_1 NA: Station_2 NA: Tree on riverside of floodwall: Clear (M)
		U	Significant vegetation growth (brush, weeds, or any trees greater than 2 inches in diameter) is present within the zones described above. This vegetation threatens the operation or integrity of the floodwall and must be removed.	LCMN_2014_a_0041: Station_1 NA: Station_2 NA: Small trees on landside: Clear (M)
2. Encroachments	A	A	No trash, debris, unauthorized structures, excavations, or other obstructions present within the easement area. Encroachments have been previously reviewed by the Corps, and it was determined that they do not diminish proper functioning of the floodwall.	
		M	Trash, debris, unauthorized structures, excavations, or other obstructions present, or inappropriate activities noted that should be corrected but will not inhibit operations and maintenance or emergency operations. Encroachments have not been reviewed by the Corps.	
		U	Unauthorized encroachments or inappropriate activities noted are likely to inhibit operations and maintenance, emergency operations, or negatively impact the integrity of the floodwall.	
3. Closure Structures (Stop Log Closures and Gates) (A or U only)	A	A	Closure structure in good repair. Placing equipment, stoplogs, and other materials are readily available at all times. Components are clearly marked and installation instructions/ procedures readily available. Trial erections have been accomplished in accordance with the O&M Manual.	LCMN_2014_a_0040: Station_1 NA: Guardrail blocking closure wingwall: Discuss alternatives and conduct a closure exercise at location to verify effectiveness of closure. (A) LCMN_2014_a_0067: Station_1 NA: Modification to Columbia Ave Bridge not approved by USACE. Work is near completion. Concerns raised during construction seem to have been addressed.: Provide as-builts. May possibly need to revise closure plan for Columbia Ave Bridge as a result of bridge modifications. (A); Columbia Ave closure exercise performed in Oct 2010. Northcote closure installed during Apr 2013 flood event. All supplies and materials readily available.
		U	Any of the following issues is cause for this rating: Closure structure in poor condition. Parts missing or corroded. Placing equipment may not be available within the anticipated warning time. The storage vaults cannot be opened during the time of inspection. Components of closure are not clearly marked and installation instructions/ procedures are not readily available. Trial erections have not been accomplished in accordance with the O&M Manual.	
		N/A	There are no closure structures along this component of the FDR segment / system.	
4. Concrete Surfaces	M	A	Negligible spalling, scaling or cracking. If the concrete surface is weathered or holds moisture, it is still satisfactory but should be seal coated to prevent freeze/ thaw damage.	LCMN_2014_a_0009: Station_1 NA: Cracks in concrete cap and spalling: Patch (M) LCMN_2014_a_0011: Station_1 NA: Cracking in cap and floodwall: Seal (M)
		M	Spalling, scaling, and open cracking present, but the immediate integrity or performance of the structure is not threatened. Reinforcing steel may be exposed. Repairs/ sealing is necessary to prevent additional damage during periods of thawing and freezing.	LCMN_2014_a_0013: Station_1 NA: Spalling on landside floodwall: Patch (M)

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 1 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
		U	Surface deterioration or deep cracks present that may result in an unreliable structure. Any surface deterioration that exposes the sheet piling or lies adjacent to monolith joints may indicate underlying reinforcement corrosion and is unacceptable.	LCMN_2014_a_0017: Station_1 NA: Concrete cap broken: Patch (M) LCMN_2014_a_0024: Station_1 NA: Sheetpile interlock joint needs repairing.: monitor the existing splice repair (A) LCMN_2014_a_0033: Station_1 NA: Typical sheetpile scaling: Monitor for any increased scaling or section loss (A) LCMN_2014_a_0039: Station_1 NA: Spalling and exposed rebar: Clean rebar and patch concrete (M) LCMN_2014_a_0044: Station_1 NA: Crack: Seal (M) LCMN_2014_a_0052: Station_1 NA: Station_2 NA: Scaling at base of sheetpile: Monitor for any increased scaling or section loss (A) LCMN_2014_a_0057: Station_1 NA: It is not normal practice or recommended to weld the interlocks of the sheet pile: Monitor (A) LCMN_2014_a_0060: Station_1 NA: Scaling of sheetpile: Monitor for any increased scaling or section loss (A) LCMN_2014_a_0066: Station_1 NA: Station_2 NA: Steel sheetpile has minor corrosion at ground level, typical throughout: Monitor for any increased scaling or section loss (A)
5. Tilting, Sliding or Settlement of Concrete Structures ²	A	A	There are no significant areas of tilting, sliding, or settlement that would endanger the integrity of the structure.	
		M	There are areas of tilting, sliding, or settlement (either active or inactive) that need to be repaired. The maximum offset, either laterally or vertically, does not exceed 2 inches unless the movement can be shown to be no longer actively occurring. The integrity of the structure is not in danger.	
		U	There are areas of tilting, sliding, or settlement (either active or inactive) that threaten the structure's integrity and performance. Any movement that has resulted in failure of the waterstop (possibly identified by daylight visible through the joint) is unacceptable. Differential movement of greater than 2 inches between any two adjacent monoliths, either laterally or vertically, is unacceptable unless it can be shown that the movement is no longer active. Also, if the floodwall is of I-wall construction, then any visible or measurable tilting of the wall toward the protected side that has created an open horizontal crack on the riverside base of a monolith is unacceptable.	
6. Foundation of	M	A	No active erosion, scouring, or bank caving that might endanger the structure's stability.	LCMN_2014_a_0006: Station_1 NA: Water ponding on

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 2 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
Concrete Structures ¹		M	There are areas where the ground is eroding towards the base of the structure. Efforts need to be taken to slow and repair this erosion, but it is not judged to be close enough to the structure or to be progressing rapidly enough to affect structural stability before the next inspection. For the purposes of inspection, the erosion or scour is not closer to the riverside face of the wall than twice the floodwall's underground base width if the wall is of L-wall or T-wall construction; or if the wall is of sheetpile or I-wall construction, the erosion is not closer than twice the wall's visible height. Additionally, rate of erosion is such that the wall is expected to remain stable until the next inspection.	landside floodwall: Grade to drain away from wall (M) LCMN_2014_a_0026: Station_1 NA: 1 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0027: Station_1 NA: 2 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0028: Station_1 NA: 3 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0029: Station_1 NA: Station_2 NA: 3 ft. deep settlement/erosion holes in fill material along base of floodwall, on landside.: Fill with stone or grout (M) LCMN_2014_a_0030: Station_1 NA: 1.5 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0031: Station_1 NA: 3 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0032: Station_1 NA: 3 ft. deep settlement/erosion holes in fill material along base of floodwall, on landside.: Fill with stone or grout (M) LCMN_2014_a_0034: Station_1 NA: 1.5 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0035: Station_1 NA: Station_2 NA: 2 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0036: Station_1 NA: 2 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0037: Station_1 NA: 2 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0038: Station_1 NA: 1 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0045: Station_1 NA: 2 ft. deep large settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0051: Station_1 NA: 6 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M)
		U	Erosion or bank caving observed that is closer to the wall than the limits described above, or is outside these limits but may lead to structural instabilities before the next inspection. Additionally, if the floodwall is of I-wall or sheetpile construction, the foundation is unacceptable if any turf, soil or pavement material got washed away from the landside of the I-wall as the result of a previous overtopping event.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 3 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
				LCMN_2014_a_0053: Station_1 NA: Deep settlement/erosion hole in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0055: Station_1 NA: Erosion next to sheetpile on riverside: Fill with grout (M) LCMN_2014_a_0056: Station_1 NA: 1 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0058: Station_1 NA: 1 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone or grout (M) LCMN_2014_a_0059: Station_1 NA: 1.5 ft. deep settlement/erosion holes in fill material along base of floodwall.: Fill with stone (M)
7. Monolith Joints	M	A	The joint material is in good condition. The exterior joint sealant is intact and cracking/desiccation is minimal. Joint filler material and/or waterstop is not visible at any point.	LCMN_2014_a_0001: Station_1 NA: Monolith joint should be re-caulked on riverside: Re-caulk (M) LCMN_2014_a_0002: Station_1 NA: Joint sealant deterioration: Re-caulk (M)
		M	The joint material has appreciable deterioration to the point where joint filler material and/or waterstop is visible in some locations. This needs to be repaired or replaced to prevent spalling and cracking during freeze/ thaw cycles, and to ensure water tightness of the joint.	LCMN_2014_a_0004: Station_1 NA: Joint sealant deterioration on landside, prior issue still exists in 2014: Re-caulk (M)
		U	The joint material is severely deteriorated or the concrete adjacent to the monolith joints has spalled and cracked, damaging the waterstop; in either case damage has occurred to the point where it is apparent that the joint is no longer watertight and will not provide the intended level of protection during a flood.	LCMN_2014_a_0007: Station_1 NA: Joint sealant deteriorating: Re-caulk (M) LCMN_2014_a_0008: Station_1 NA: Station_2 NA: Joint sealant deteriorating: Re-caulk (M)
		N/A	There are no monolith joints in the floodwall.	LCMN_2014_a_0015: Station_1 NA: Joint cracked and requires caulking: NA (M) LCMN_2014_a_0019: Station_1 NA: Joint deterioration: Re-caulk (M)
8. Underseepage Relief Wells/ Toe Drainage Systems	NA	A	Toe drainage systems and pressure relief wells necessary for maintaining FDR segment / system stability during high water functioned properly during the last flood event and no sediment is observed in horizontal system (if applicable). Nothing is observed which would indicate that the drainage systems won't function properly during the next flood, and maintenance records indicate regular cleaning. Wells have been pumped tested within the past 5 years and documentation is provided.	
		M	Toe drainage systems or pressure relief wells are damaged and may become clogged if they are not repaired. Maintenance records are incomplete or indicate irregular cleaning and pump testing.	
		U	Toe drainage systems or pressure relief wells necessary for maintaining FDR segment / system stability during flood events have fallen into disrepair or have become clogged. No maintenance records. No documentation of the required pump testing.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System Inspection Report Little Cal - Munster (LCMN)

Floodwalls
Page 4 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
		N/A	There are no relief wells/ toe drainage systems along this component of the FDR segment / system.	
9. Seepage	A	A	No evidence or history of unrepaired seepage, saturated areas, or boils.	
		M	Evidence or history of minor unrepaired seepage or small saturated areas at or beyond the landside toe but not on the landward slope of levee. No evidence of soil transport.	
		U	Evidence or history of active seepage, extensive saturated areas, or boils.	

¹ Inspectors must have as-built drawings available during the inspection so that the lateral distance to the heel and toe of the floodwalls can be determined in the field.

² The sponsor should be monitoring any observed movement to verify whether the movement is active or inactive.

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 5 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0003 **Title:** USACE_CELRC_LCMN_2014_a_0003_1.jpg
Rated Item: 1. Unwanted Vegetation Growth **Caption:** Rating: Minimally Acceptable;
Remarks: Small trees along floodwall; **Action:** Clear



Inspect ID: LCMN_2014_a_0016 **Title:** USACE_CELRC_LCMN_2014_a_0016_1.jpg
Rated Item: 1. Unwanted Vegetation Growth **Caption:** Rating: Minimally Acceptable;
Remarks: Trees on riverside of floodwall at Northcote; **Action:** Clear



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 6 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0020 **Title:** USACE_CELRC_LCMN_2014_a_0020_1.jpg
Rated Item: 1. Unwanted Vegetation Growth **Caption:** Rating: Minimally Acceptable;
Remarks: Bush on riverside; Action: Clear



Inspect ID: LCMN_2014_a_0021 **Title:** USACE_CELRC_LCMN_2014_a_0021_1.jpg
Rated Item: 1. Unwanted Vegetation Growth **Caption:** Rating: Minimally Acceptable;
Remarks: Tall brush on riverside; Action: Clear



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 7 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0023 **Title:** USACE_CELRC_LCMN_2014_a_0023_1.jpg
Rated Item: 1. Unwanted Vegetation Growth **Caption:** Rating: Minimally Acceptable;
Remarks: Tree on riverside of floodwall; Action: Clear



Inspect ID: LCMN_2014_a_0041 **Title:** USACE_CELRC_LCMN_2014_a_0041_1.jpg
Rated Item: 1. Unwanted Vegetation Growth **Caption:** Rating: Minimally Acceptable;
Remarks: Small trees on landside; Action: Clear



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 8 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0040 **Title:** USACE_CELRC_LCMN_2014_a_0040_1.jpg
Rated Item: 3. Closure Structures (Stop Log Closures and Gates) (A or U only)
Caption: Rating: Acceptable; Remarks: Guardrail blocking closure wingwall; Action: Discuss alternatives and conduct a closure exercise at location to verify effectiveness of closure.



Inspect ID: LCMN_2014_a_0067 **Title:** USACE_CELRC_LCMN_2014_a_0067_1.jpg
Rated Item: 3. Closure Structures (Stop Log Closures and Gates) (A or U only)
Caption: Rating: Acceptable; Remarks: Modification to Columbia Ave Bridge not approved by USACE. Work is near completion. Concerns raised during construction seem to have been addressed. ; Action: Provide as-builts. May possibly need to revise closure plan for Columbia Ave Bridge as a result of bridge modifications.



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 9 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0009 **Title:** USACE_CELRC_LCMN_2014_a_0009_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Minimally Acceptable; Remarks:
Cracks in concrete cap and spalling; Action: Patch



Inspect ID: LCMN_2014_a_0011 **Title:** USACE_CELRC_LCMN_2014_a_0011_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Minimally Acceptable; Remarks:
Cracking in cap and floodwall; Action: Seal



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 10 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0013 **Title:** USACE_CELRC_LCMN_2014_a_0013_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Minimally Acceptable; Remarks:
Spalling on landside floodwall; Action: Patch



Inspect ID: LCMN_2014_a_0017 **Title:** USACE_CELRC_LCMN_2014_a_0017_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Minimally Acceptable; Remarks:
Concrete cap broken; Action: Patch



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 11 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0024 **Title:** USACE_CELRC_LCMN_2014_a_0024_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Acceptable; Remarks: Sheetpile interlock joint needs repairing.; Action: monitor the existing splice repair



Inspect ID: LCMN_2014_a_0033 **Title:** USACE_CELRC_LCMN_2014_a_0033_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Acceptable; Remarks: Typical sheetpile scaling; Action: Monitor for any increased scaling or section loss



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 12 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0039 **Title:** USACE_CELRC_LCMN_2014_a_0039_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Minimally Acceptable; Remarks: Spalling and exposed rebar; Action: Clean rebar and patch concrete



Inspect ID: LCMN_2014_a_0052 **Title:** USACE_CELRC_LCMN_2014_a_0052_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Acceptable; Remarks: Scaling at base of sheetpile; Action: Monitor for any increased scaling or section loss; and possible sheetpile alignment issues



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 13 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0057 **Title:** USACE_CELRC_LCMN_2014_a_0057_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Acceptable; Remarks: It is not normal practice or recommended to weld the interlocks of the sheet pile; Action: Monitor



Inspect ID: LCMN_2014_a_0060 **Title:** USACE_CELRC_LCMN_2014_a_0060_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Acceptable; Remarks: Scaling of sheetpile; Action: Monitor for any increased scaling or section loss



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 14 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0066 **Title:** USACE_CELRC_LCMN_2014_a_0066_1.jpg
Rated Item: 4. Concrete Surfaces **Caption:** Rating: Acceptable; Remarks: Steel sheetpile has minor corrosion at ground level, typical throughout; Action: Monitor for any increased scaling or section loss



Inspect ID: LCMN_2014_a_0006 **Title:** USACE_CELRC_LCMN_2014_a_0006_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: Water ponding on landside floodwall; Action: Grade to drain away from wall



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 15 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0026 **Title:** USACE_CELRC_LCMN_2014_a_0026_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 1 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



Inspect ID: LCMN_2014_a_0027 **Title:** USACE_CELRC_LCMN_2014_a_0027_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 2 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 16 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0028 **Title:** USACE_CELRC_LCMN_2014_a_0028_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 3 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



Inspect ID: LCMN_2014_a_0029 **Title:** USACE_CELRC_LCMN_2014_a_0029_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 3 ft. deep settlement/erosion holes in fill material along base of floodwall, on landside.; Action: Fill with stone or grout



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 17 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0030 **Title:** USACE_CELRC_LCMN_2014_a_0030_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 1.5 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



Inspect ID: LCMN_2014_a_0031 **Title:** USACE_CELRC_LCMN_2014_a_0031_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 3 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 18 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0032 **Title:** USACE_CELRC_LCMN_2014_a_0032_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 3 ft. deep settlement/erosion holes in fill material along base of floodwall, on landside.; Action: Fill with stone or grout



Inspect ID: LCMN_2014_a_0034 **Title:** USACE_CELRC_LCMN_2014_a_0034_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 1.5 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 19 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0035 **Title:** USACE_CELRC_LCMN_2014_a_0035_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 2 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



Inspect ID: LCMN_2014_a_0036 **Title:** USACE_CELRC_LCMN_2014_a_0036_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 2 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 20 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0037 **Title:** USACE_CELRC_LCMN_2014_a_0037_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 2 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



Inspect ID: LCMN_2014_a_0038 **Title:** USACE_CELRC_LCMN_2014_a_0038_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 1 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 21 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0045 **Title:** USACE_CELRC_LCMN_2014_a_0045_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 2 ft. deep large settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



Inspect ID: LCMN_2014_a_0051 **Title:** USACE_CELRC_LCMN_2014_a_0051_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 6 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 22 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0053 **Title:** USACE_CELRC_LCMN_2014_a_0053_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: Deep settlement/erosion hole in fill material along base of floodwall.; Action: Fill with stone or grout



Inspect ID: LCMN_2014_a_0055 **Title:** USACE_CELRC_LCMN_2014_a_0055_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: Erosion next to sheetpile on riverside; Action: Fill with grout



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 23 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0056 **Title:** USACE_CELRC_LCMN_2014_a_0056_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 1 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



Inspect ID: LCMN_2014_a_0058 **Title:** USACE_CELRC_LCMN_2014_a_0058_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 1 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone or grout



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 24 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0059 **Title:** USACE_CELRC_LCMN_2014_a_0059_1.jpg
Rated Item: 6. Foundation of Concrete Structures **Caption:** Rating: Minimally Acceptable; Remarks: 1.5 ft. deep settlement/erosion holes in fill material along base of floodwall.; Action: Fill with stone



Inspect ID: LCMN_2014_a_0001 **Title:** USACE_CELRC_LCMN_2014_a_0001_1.jpg
Rated Item: 7. Monolith Joints **Caption:** Rating: Minimally Acceptable; Remarks: Monolith joint should be re-caulked on riverside; Action: Re-caulk



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 25 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0002 **Title:** USACE_CELRC_LCMN_2014_a_0002_1.jpg
Rated Item: 7. Monolith Joints **Caption:** Rating: Minimally Acceptable; Remarks: Joint sealant deterioration; Action: Re-caulk



Inspect ID: LCMN_2014_a_0004 **Title:** USACE_CELRC_LCMN_2014_a_0004_1.jpg
Rated Item: 7. Monolith Joints **Caption:** Rating: Minimally Acceptable; Remarks: Joint sealant deterioration on landside, prior issue still exists in 2014; Action: Re-caulk



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 26 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0007 **Title:** USACE_CELRC_LCMN_2014_a_0007_1.jpg
Rated Item: 7. Monolith Joints **Caption:** Rating: Minimally Acceptable; Remarks: Joint sealant deteriorating; Action: Re-caulk



Inspect ID: LCMN_2014_a_0008 **Title:** USACE_CELRC_LCMN_2014_a_0008_1.jpg
Rated Item: 7. Monolith Joints **Caption:** Rating: Minimally Acceptable; Remarks: Joint sealant deteriorating; Action: Re-caulk



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 27 of 28

Floodwalls

For use during Initial and Continuing Eligibility Inspections of all floodwalls



Inspect ID: LCMN_2014_a_0015 **Title:** USACE_CELRC_LCMN_2014_a_0015_1.jpg
Rated Item: 7. Monolith Joints **Caption:** Rating: Minimally Acceptable; Remarks: Joint cracked and requires caulking; Action: NA



Inspect ID: LCMN_2014_a_0019 **Title:** USACE_CELRC_LCMN_2014_a_0019_1.jpg
Rated Item: 7. Monolith Joints **Caption:** Rating: Minimally Acceptable; Remarks: Joint deterioration; Action: Re-caulk



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Floodwalls
Page 28 of 28

Interior Drainage System

For use during Initial and Continuing Eligibility Inspections of interior drainage systems

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
1. Vegetation and Obstructions	M	A	No obstructions, vegetation, debris, or sediment accumulation noted within interior drainage channels or blocking the culverts, inlets, or discharge areas. Concrete joints and weep holes are free of grass and weeds.	LCMN_2014_a_0068: Station_1 NA: MU-1: Debris at inlet: Clean (M) LCMN_2014_a_0069: Station_1 NA: MU-2: Outlet clogged with trash and silt: Clean (M) LCMN_2014_a_0070: Station_1 NA: MU-4: Thick vegetation at outlet: Clear (M) LCMN_2014_a_0071: Station_1 NA: MU-7: Minor debris at outlet: Clean (A) LCMN_2014_a_0072: Station_1 NA: MU-11: Some vegetation at outlet pipe: Clear (M)
		M	Obstructions, vegetation, debris, or sediment are minor and have not impaired channel flow capacity or blocked more than 10% of any culvert openings, but should be removed. A limited volume of grass and weeds may be present in concrete channel joints and weep holes.	
		U	Obstructions, vegetation, debris, or sediment have impaired the channel flow capacity or blocked more than 10% of a culvert opening. Sediment and debris removal required to re-establish flow capacity.	
2. Encroachments	A	A	No trash, debris, unauthorized structures, excavations, or other obstructions present within the easement area. Encroachments have been previously reviewed by the Corps, and it was determined that they do not diminish proper functioning of the interior drainage system.	
		M	Trash, debris, unauthorized structures, excavations, or other obstructions present, or inappropriate activities noted that should be corrected but will not inhibit operations and maintenance or emergency operations. Encroachments have not been reviewed by the Corps.	
		U	Unauthorized encroachments or inappropriate activities noted are likely to inhibit operations and maintenance, emergency operations, or negatively impact the integrity of this component of the interior drainage system.	
3. Ponding Areas	A	A	No trash, debris, structures, or other obstructions present within the ponding areas. Sediment deposits do not exceed 10% of capacity.	
		M	Trash, debris, excavations, structures, or other obstructions present, or inappropriate activities that will not inhibit operations and maintenance. Sediment deposits do not exceed 30% of capacity.	
		U	Trash, debris, excavations, structures, or other obstructions, or other encroachments or activities noted that will inhibit operations, maintenance, or emergency work. Sediment deposits exceeds 30% of capacity.	
		N/A	There are no ponding areas associated with the interior drainage system.	
4. Fencing and Gates ¹	A	A	Fencing is in good condition and provides protection against falling or unauthorized access. Gates open and close freely, locks are in place, and there is little corrosion on metal parts.	
		M	Fencing or gates are damaged or corroded but appear to be maintainable. Locks may be missing or damaged.	
		U	Fencing and gates are damaged or corroded to the point that replacement is required, or potentially dangerous features are not secured.	
		N/A	There are no features noted that require safety fencing.	
5. Concrete Surfaces (Such as gate)	M	A	Negligible spalling, scaling or cracking. If the concrete surface is weathered or holds moisture, it is still satisfactory but should be seal coated to prevent freeze/ thaw damage.	LCMN_2014_a_0063: Station_1 NA: Erosion next to outlet: Fill (M)

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Interior Drainage System
Page 1 of 8

Interior Drainage System

For use during Initial and Continuing Eligibility Inspections of interior drainage systems

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
wells, outfalls, intakes, or culverts)		M	Spalling, scaling, and open cracking present, but the immediate integrity or performance of the structure is not threatened. Reinforcing steel may be exposed. Repairs/ sealing is necessary to prevent additional damage during periods of thawing and freezing.	
		U	Surface deterioration or deep cracks present that may result in an unreliable structure. Any surface deterioration that exposes the sheet piling or lies adjacent to monolith joints may indicate underlying reinforcement corrosion and is unacceptable.	
		N/A	There are no concrete items in the interior drainage system.	
6. Tilting, Sliding or Settlement of Concrete and Sheet Pile Structures ² (Such as gate wells, outfalls, intakes, or culverts)	A	A	There are no significant areas of tilting, sliding, or settlement that would endanger the integrity of the structure.	
		M	There are areas of tilting, sliding, or settlement (either active or inactive) that need to be repaired. The maximum offset, either laterally or vertically, does not exceed 2 inches unless the movement can be shown to be no longer actively occurring. The integrity of the structure is not in danger.	
		U	There are areas of tilting, sliding, or settlement (either active or inactive) that threaten the structure's integrity and performance. Any movement that has resulted in failure of the waterstop (possibly identified by daylight visible through the joint) is unacceptable. Differential movement of greater than 2 inches between any two adjacent monoliths, either laterally or vertically, is unacceptable unless it can be shown that the movement is no longer active. Also, if the floodwall is of I-wall construction, then any visible or measurable tilting of the wall toward the protected side that has created an open horizontal crack on the riverside base of a monolith is unacceptable.	
		N/A	There are no concrete items in the interior drainage system.	
7. Foundation of Concrete Structures ³ (Such as culverts, inlet and discharge structures, or gatewells.)	A	A	No active erosion, scouring, or bank caving that might endanger the structure's stability.	
		M	There are areas where the ground is eroding towards the base of the structure. Efforts need to be taken to slow and repair this erosion, but it is not judged to be close enough to the structure or to be progressing rapidly enough to affect structural stability before the next inspection. The rate of erosion is such that the structure is expected to remain stable until the next inspection.	
		U	Erosion or bank caving observed that may lead to structural instabilities before the next inspection.	
		N/A	There are no concrete items in the interior drainage system.	
8. Monolith Joints	A	A	The joint material is in good condition. The exterior joint sealant is intact and cracking/ desiccation is minimal. Joint filler material and/or waterstop is not visible at any point.	
		M	The joint material has appreciable deterioration to the point where joint filler material and/or waterstop is visible in some locations. This needs to be repaired or replaced to prevent spalling and cracking during freeze/ thaw cycles, and to ensure water tightness of the joint.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Interior Drainage System
Page 2 of 8

Interior Drainage System

For use during Initial and Continuing Eligibility Inspections of interior drainage systems

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
		U	The joint material is severely deteriorated or the concrete adjacent to the monolith joints has spalled and cracked, damaging the waterstop; in either case damage has occurred to the point where it is apparent that the joint is no longer watertight and will not provide the intended level of protection during a flood.	
		N/A	There are no monolith joints in the interior drainage system.	
9. Culverts/ Discharge Pipes ⁴	A	A	There are no breaks, holes, cracks in the discharge pipes/ culverts that would result in significant water leakage. The pipe shape is still essentially circular. All joints appear to be closed and the soil tight. Corrugated metal pipes, if present, are in good condition with 100% of the original coating still in place (either asphalt or galvanizing) or have been relined with appropriate material, which is still in good condition. Condition of pipes has been verified using television camera video taping or visual inspection methods within the past five years, and the report for every pipe is available for review by the inspector.	Culvert inspection performed in 2012. Inspection results were reviewed and no issues were identified. Next inspection should be performed in 2017.
		M	There are a small number of corrosion pinholes or cracks that could leak water and need to be repaired, but the entire length of pipe is still structurally sound and is not in danger of collapsing. Pipe shape may be ovalized in some locations but does not appear to be approaching a curvature reversal. A limited number of joints may have opened and soil loss may be beginning. Any open joints should be repaired prior to the next inspection. Corrugated metal pipes, if present, may be showing corrosion and pinholes but there are no areas with total section loss. Condition of pipes has been verified using television camera video taping or visual inspection methods within the past five years, and the report for every pipe is available for review by the inspector.	
		U	Culvert has deterioration and/or has significant leakage; it is in danger of collapsing or as already begun to collapse. Corrugated metal pipes have suffered 100% section loss in the invert. HOWEVER: Even if pipes appear to be in good condition, as judged by an external visual inspection, an Unacceptable Rating will be assigned if the condition of pipes has not been verified using television camera video taping or visual inspection methods within the past five years, and reports for all pipes are not available for review by the inspector.	
		N/A	There are no discharge pipes/ culverts.	
10. Sluice / Slide Gates ⁵	M	A	Gates open and close freely to a tight seal or minor leakage. Gate operators are in good working condition and are properly maintained. Sill is free of sediment and other obstructions. Gates and lifters have been maintained and are free of corrosion. Documentation provided during the inspection.	LCMN_2014_a_0073: Station_1 NA: MU-11: Bee hive in riser stem: Remove (M)
		M	Gates and/or operators have been damaged or have minor corrosion, and open and close with resistance or binding. Leakage quantity is controllable, but maintenance is required. Sill is free of sediment and other obstructions.	
		U	Gates do not open or close and/or operators do not function. Gate, stem, lifter and/or guides may be damaged or have major corrosion.	
		N/A	There are no sluice/ slide gates.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Interior Drainage System
Page 3 of 8

Interior Drainage System

For use during Initial and Continuing Eligibility Inspections of interior drainage systems

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
11. Flap Gates/ Flap Valves/ Pinch Valves ¹	A	A	Gates/ valves open and close easily with minimal leakage, have no corrosion damage, and have been exercised and lubricated as required.	
		M	Gates/ valves will not fully open or close because of obstructions that can be easily removed, or have minor corrosion damage that requires maintenance.	
		U	Gates/ valves are missing, have been damaged, or have deteriorated to the point that they need to be replaced.	
		N/A	There are no flap gates.	
12. Trash Racks (non-mechanical)	A	A	Trash racks are fastened in place and properly maintained.	
		M	Trash racks are in place but are unfastened or have bent bars that allow debris to enter into the pipe or pump station, bars are corroded to the point that up to 10% of the sectional area may be lost. Repair or replacement is required.	
		U	Trash racks are missing or damaged to the extent that they are no longer functional and must be replaced. (For example, more than 10% of the sectional area may be lost.)	
		N/A	There are no trash racks, or they are covered in the pump stations section of the report.	
13. Other Metallic Items	A	A	All metal parts are protected from corrosion damage and show no rust, damage, or deterioration that would cause a safety concern.	
		M	Corrosion seen on metallic parts appears to be maintainable.	
		U	Metallic parts are severely corroded and require replacement to prevent failure, equipment damage, or safety issues.	
		N/A	There are no other significant metallic items.	
14. Riprap Revetments of Inlet/ Discharge Areas	A	A	No riprap displacement or stone degradation that could pose an immediate threat to the integrity of channel bank. Riprap intact with no woody vegetation present.	
		M	Minor riprap displacement or stone degradation that could pose an immediate threat to the integrity of the channel bank. Unwanted vegetation must be cleared or sprayed with an appropriate herbicide.	
		U	Significant riprap displacement, exposure of bedding, or stone degradation observed. Scour activity is undercutting banks, eroding embankments, or impairing channel flows by causing turbulence or shoaling. Rock protection is hidden by dense brush, trees, or grasses.	
		N/A	There is no riprap protecting this feature of the segment / system, or riprap is discussed in another section.	
15. Revetments other than Riprap	A	A	No riprap displacement or stone degradation that could pose an immediate threat to the integrity of channel bank. Riprap intact with no woody vegetation present.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Interior Drainage System
Page 4 of 8

Interior Drainage System

For use during Initial and Continuing Eligibility Inspections of interior drainage systems

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
		M	Minor riprap displacement or stone degradation that could pose an immediate threat to the integrity of the channel bank. Unwanted vegetation must be cleared or sprayed with an appropriate herbicide.	
		U	Significant riprap displacement, exposure of bedding, or stone degradation observed. Scour activity is undercutting banks, eroding embankments, or impairing channel flows by causing turbulence or shoaling. Rock protection is hidden by dense brush, trees, or grasses.	
		N/A	There are no such revetments protecting this feature of the segment / system.	

¹ Proper operation of this item must be demonstrated during the inspection.

² The sponsor should be monitoring any observed movement to verify whether the movement is active or inactive.

³ Inspectors must have as-built drawings available during the inspection so that the lateral distance to the heel and toe of the floodwalls can be determined in the field.

⁴ The decision on whether or not USACE inspectors should enter a pipe to perform a detailed inspection must be made at the USACE District level. This decision should be made in conjunction with the District Safety Office, as pipes may be considered confined spaces. This decision should consider the age of the pipe, the diameter of the pipe, the apparent condition of the pipe, and the length of the pipe. If a pipe is entered for the purposes of inspection, the inspector should record observations with a video camera in order that the condition of the entire pipe, including all joints, can later be assessed. Additionally, the video record provides a baseline to which future inspections can be compared.

⁵ Proper operation of the gates (full open and closed) must be demonstrated during the inspection if no documentation is available. Be aware of both manual and electrical operators.

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Interior Drainage System
Page 5 of 8

Interior Drainage System

For use during Initial and Continuing Eligibility Inspections of interior drainage systems



Inspect ID: LCMN_2014_a_0068 **Title:** USACE_CELRC_LCMN_2014_a_0068_1.jpg
Rated Item: 1. Vegetation and Obstructions **Caption:** Rating: Minimally Acceptable;
Remarks: MU-1: Debris at inlet; Action: Clean



Inspect ID: LCMN_2014_a_0069 **Title:** USACE_CELRC_LCMN_2014_a_0069_1.jpg
Rated Item: 1. Vegetation and Obstructions **Caption:** Rating: Minimally Acceptable;
Remarks: MU-2: Outlet clogged with trash and silt; Action: Clean



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Interior Drainage System
Page 6 of 8

Interior Drainage System

For use during Initial and Continuing Eligibility Inspections of interior drainage systems



Inspect ID: LCMN_2014_a_0070 **Title:** USACE_CELRC_LCMN_2014_a_0070_1.jpg
Rated Item: 1. Vegetation and Obstructions **Caption:** Rating: Minimally Acceptable;
Remarks: MU-4: Thick vegetation at outlet; Action: Clear



Inspect ID: LCMN_2014_a_0071 **Title:** USACE_CELRC_LCMN_2014_a_0071_1.jpg
Rated Item: 1. Vegetation and Obstructions **Caption:** Rating: Acceptable; **Remarks:** MU-7: Minor debris at outlet; Action: Clean



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Interior Drainage System
Page 7 of 8

Interior Drainage System

For use during Initial and Continuing Eligibility Inspections of interior drainage systems

	<p>Inspect ID: LCMN_2014_a_0072 Title: USACE_CELRC_LCMN_2014_a_0072_1.jpg Rated Item: 1. Vegetation and Obstructions Caption: Rating: Minimally Acceptable; Remarks: MU-11: Some vegetation at outlet pipe; Action: Clear</p>
	<p>Inspect ID: LCMN_2014_a_0063 Title: USACE_CELRC_LCMN_2014_a_0063_1.jpg Rated Item: 5. Concrete Surfaces (Such as gate wells, outfalls, intakes, or culverts) Caption: Rating: Minimally Acceptable; Remarks: Erosion next to outlet; Action: Fill</p>



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Interior Drainage System
Page 8 of 8

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
1. Pump Stations Operating, Maintenance, Training, & Inspection Records	A	A	Operation, maintenance and inspection records are present at the pump station and are being used and updated, and personnel have been trained in pump station operations. Names and last training date shown in the record book.	
		M	Operation, maintenance and inspection records are present but not adequately used and updated.	
		U	No operation, maintenance and inspection records are present, or refresher training for personnel has not been conducted.	
2. Pump Station Operations and Maintenance Equipment Manuals	U	A	Operation and Maintenance Equipment Manuals and/or posted operating instructions are present and updated as required, and adequately cover all pertinent pump station features. O&M manuals include points of contact for manufacturers and suppliers of major equipment used in the facility.	LCMN_2014_a_0074: Station_1 NA: PS-OA: No O&M manuals: Provide manuals at the pump station (U)
		M	Operation and Maintenance Equipment Manuals and/or posted operating instructions are present and adequately cover all pertinent pump station features. However, they are incomplete and the necessary updates have not been made.	
		U	Operation and Maintenance Equipment Manuals are not available.	
3. Safety Compliance	M	A	Safety compliance inspection reports by applicable local, state, or federal agencies available for review.	LCMN_2014_a_0075: Station_1 NA: PS-OA: Non-standard exit sign: Replace with compliant signage (M) LCMN_2014_a_0081: Station_1 NA: PS-OA: MCC and pump control cabinet must be posted with proper Arc-Flash warning sign per latest NFPA 70 and NFPA70E: Post Arc-Flash warning signs (M) LCMN_2014_a_0085: Station_1 NA: PS-BA: MCC and pump control cabinet must be posted with proper Arc-Flash warning sign per latest NFPA 70 and NFPA70E: Post Arc-Flash warning signs (M) LCMN_2014_a_0092: Station_1 NA: PS-CAL: MCC and pump control cabinet must be posted with proper Arc-Flash warning sign per latest NFPA 70 and NFPA70E: Post Arc-Flash warning signs (M)
		M	No safety compliance inspection reports are available for review.	
4. Communications (A or M only)	A	A	A telephone, cellular phone, two-way radio, or similar device is available to pump station operator and maintenance personnel.	
		M	A telephone, cellular phone, two-way radio, or similar device is not available to pump station operator and maintenance personnel.	
5. Plant Building	M	A	The building is in good structural condition with no major foundation settlement problems. The roof is not leaking, intake & exhaust louvers are clear of debris, fans are operational, etc.	LCMN_2014_a_0076: Station_1 NA: PS-OA: Insulation starting to peel off of pipe in trash rake room and possible

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 1 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
		M	There are minor structural defects, minimal foundation settlement, leaks, or other conditions noted that need repair. Defects do not threaten the structural integrity or stability of the building, and will not impact pumping operations.	water damage to the masonry wall.: Repair insulation, clean wall (M) LCMN_2014_a_0077: Station_1 NA: PS-OA: Deteriorating seal at lintel: Seal (M)
		U	The structural integrity or stability of the building is threatened, or there is damage to the building that threatens safety of the operator or impacts pumping operations.	LCMN_2014_a_0084: Station_1 NA: PS-BA: Exposed rebar in concrete: Patch (M) LCMN_2014_a_0086: Station_1 NA: PS-CAL: Broken concrete and leaking at skylights: Seal cracks (M) LCMN_2014_a_0087: Station_1 NA: PS-CAL: Exposed rebar: Patch concrete (M) LCMN_2014_a_0088: Station_1 NA: PS-CAL: Spalling in foundation slab: Patch (M) LCMN_2014_a_0095: Station_1 NA: PS-HM: Deteriorating lintel: Fix (M) LCMN_2014_a_0096: Station_1 NA: PS-HM: Broken masonry at south window: Fix masonry (M) LCMN_2014_a_0097: Station_1 NA: PS-HM: Masonry under vent deteriorating: Repair (M) LCMN_2014_a_0098: Station_1 NA: PS-HM: Cracking of masonry wall: Seal (M) LCMN_2014_a_0099: Station_1 NA: PS-HM: Cracking of masonry wall: Seal (M)
6. Fencing and Gates ¹	M	A	Fencing is in good condition and provides protection against falling or unauthorized access. Gates open and close freely, locks are in place, and there is little corrosion on metal parts.	LCMN_2014_a_0078: Station_1 NA: PS-OA: Damaged fence: Repair (M)
		M	Fencing or gates are damaged or corroded but appear to be maintainable. Locks may be missing or damaged.	LCMN_2014_a_0079: Station_1 NA: PS-OA: Coating peeling: Reapply coat (M)
		U	Fencing and gates are damaged or corroded to the point that replacement is required, or potentially dangerous features are not secured.	LCMN_2014_a_0080: Station_1 NA: PS-OA: Damaged fence: Repair (M)
		N/A	There are no features noted that require safety fencing.	LCMN_2014_a_0089: Station_1 NA: PS-CAL: Rusted fencing: Clean (A) LCMN_2014_a_0090: Station_1 NA: PS-CAL: Damaged fence: Repair (M)
7. Pumps ¹	A	A	All pumps are properly maintained and lubricated. Systems are periodically tested and documented for review. No vibration, cavitation noises or unusual sounds are noted when the pump is operated. Bearing temperature sensor records don't indicate any problems.	
		M	Minor deficiencies noted that need to be closely monitored or repaired, such as the presence of slight vibrations, leakage of packing gland, bearing temperature sensors are inoperable or no record is present. However, the pumps are operational and are expected to perform through the next period of usage.	
		U	Major deficiencies identified that may significantly reduce pumping operations. For example, bearing sensor records indicate problems, excessive vibration noted, impellers are badly	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System Inspection Report Little Cal - Munster (LCMN)

Pump Stations
Page 2 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
			corroded, or there are eroded or missing blades.	
8. Motors, Engines, Fans, Gear Reducers, Back Stop Devices, etc.	A	A	All items are operational. Preventative maintenance and lubrication is being performed and the system is periodically subjected to performance testing. Instrumentation, alarms, bearing sensors and auto shutdowns are operational.	
		M	Systems have minor deficiencies, but are operational and will function adequately through the next flood. Bearing sensors are not operational.	
		U	One or more of the primary motors or systems is not operational, or noted deficiencies have not been corrected.	
9. Sumps / Wet well	A	A	Clear of debris, sediment, or other obstructions. Procedures are in place to remove debris accumulation during operation.	
		M	Debris, sediment, or other obstructions may be present and must be removed, but the sump/ wet well will function as intended during the next flood. Procedures are in place to remove debris accumulation during operation.	
		U	Large debris or excessive silt present which will hinder or damage pumps during operation, or no procedures established to remove debris accumulation during operation.	
10. Mechanical Operating Trash Rakes ¹	M	A	Drive chain, bearing, gear reducers, and other components are in good operating condition and are being properly maintained.	LCMN_2014_a_0091: Station_1 NA: PS-CAL: Corroding trash rake: Clean and paint (M)
		M	The trash rake is in need of maintenance, but is still operational.	
		U	Trash rake not operational or deficiencies will inhibit operations during the next flood event.	
		N/A	There are no mechanical trash rakes.	
11. Non-Mechanical Trash Racks	A	A	Trash racks are fastened in place and properly maintained.	
		M	Trash racks are in place but are unfastened or have bent bars that allow debris to enter into the pipe or pump station, bars are corroded to the point that up to 10% of the sectional area may be lost. Repair or replacement is required.	
		U	Trash racks are missing or damaged to the extent that they are no longer functional and must be replaced. (For example, more than 10% of the sectional area may be lost.)	
		N/A	There are no trash racks, or they are covered in the pump stations section of the report.	
12. Fuel System for Pump Engines	A	A	Fuel system is operational, day tank present and operational, fuel fresh and rotated regularly.	
		M	Fuel system is operational and of adequate capacity, but day tank is missing or fuel is not fresh and rotated regularly.	
		U	Fuel system not functional.	
		N/A	No fuel system.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 3 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
13. Power Source	A	A	The normal power source and backup generators, if installed, are operational, properly exercised and well maintained. Surge protection, grounding, lightning protection, transformers, and automatic/manual transfer of main power to backup system is working.	
		M	Normal power source and backup units, if applicable, are operational with minor discrepancies or maintenance, inspection and exercising record is present but not up to date. Preventative maintenance or repairs are required.	
		U	Normal power source or generators are not operational and must be repaired; or generator, if required, is not on site.	
14. Electrical Systems ²	A	A	Operational and maintained free of damage, corrosion, and debris. Preventative maintenance and system testing is being performed periodically.	
		M	Operational with minor discrepancies. Preventative maintenance or repairs are required, but the components are expected to function adequately during the next flood event.	
		U	Components of the electrical system will not function adequately during the next flood event and must be replaced.	
15. Megger Testing on Pump Motors and Critical Power Cables	M	A	Results of megger tests on pump motors or critical power cables show that the insulation meets manufacturer's or industry standards. Tested within the last year.	Outlot A and Calumet pump stations tested in Sept 2013. Sponsor informed that testing was performed on Baring and Hohman-Munster but reports were not provided (M).
		M	Megger testing not conducted within the past year. If megger tests on pump motors indicate that insulation resistance is below the manufacturer's or industry standard, but the resistance can be corrected with proper application of heat, this is minimally acceptable. (The application of heat does not relate to critical power cables.)	
		U	Megger tests not conducted within past two years, or tests indicate that insulation resistance is low enough that the equipment will not be able to meet design standards of operation; or evidence of arcing or shorting is detected visually.	
16. Enclosures, Panels, Conduit and Ducts	M	A	All enclosures, panels, conduits, and ducts are protected from corrosion damage and show no rust, damage, or deterioration that would cause a safety concern.	LCMN_2014_a_0082: Station_1 NA: PS-OA: Exterior duplex receptacle is broken: Replace (M) LCMN_2014_a_0083: Station_1 NA: PS-OA: Paint peeling: Repaint (M) LCMN_2014_a_0100: Station_1 NA: PS-HM: Corroded conduit exiting the wall and laying on the ground: Repair (M)
		M	Minor surface corrosion which appears to be maintainable. Cleaning and painting required.	
		U	Severely corroded and must be replaced to prevent failure, equipment damage, or safety issues.	
17. Intake and Discharge	A	A	Intake and discharge pipelines have no corrosion and paint is intact, except for minor touch up required. Pipe couplings and anchors have no leakage or corrosion.	

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System Inspection Report Little Cal - Munster (LCMN)

Pump Stations
Page 4 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
Pipelines		M	Intake and discharge pipelines have minor corrosion and repair and painting is required. Pipe coupling with anchors have minor leakage, corrosion and require bolts to be tightened.	
		U	Intake and discharge pipelines have major corrosion and replacement is required. Pipe coupling with anchors have major leakage and is heavily corroded and requires replacement.	
18. Sluice/ Slide Gates ³	A	A	Gates open and close freely to a tight seal or minor leakage. Gate operators are in good working condition and are properly maintained. Sill is free of sediment and other obstructions. Gates and lifters have been maintained and are free of corrosion. Documentation provided during the inspection.	
		M	Gates and/or operators have been damaged or have minor corrosion, and open and close with resistance or binding. Leakage quantity is controllable, but maintenance is required. Sill is free of sediment and other obstructions.	
		U	Gates do not open or close and/or operators do not function. Gate, stem, lifter and/or guides may be damaged or have major corrosion.	
		N/A	There are no sluice/ slide gates.	
19. Flap Gates/ Flap Valves/ Pinch Valves ¹	A	A	Gates/ valves open and close easily with minimal leakage, have no corrosion damage, and have been exercised and lubricated as required.	
		M	Gates/ valves will not fully open or close because of obstructions that can be easily removed, or have minor corrosion damage that requires maintenance.	
		U	Gates/ valves are missing, have been damaged, or have deteriorated to the point that they need to be replaced.	
		N/A	There are no gates on discharge lines from pump station.	
20. Cranes ¹	A	A	Cranes operational and have been inspected and load tested in accordance with applicable standards within the last year. Documentation is on hand.	
		M	Cranes have not been inspected or operationally tested within the past year, or there are visible signs of corrosion, oil leakage, etc, requiring maintenance.	
		U	Cranes are not operational, and this may prevent the pump station from functioning as required. No documentation available on cranes.	
		N/A	There are no cranes.	
21. Other Metallic Items	M	A	All metal parts are protected from corrosion damage and show no rust, damage, or deterioration that would cause a safety concern.	LCMN_2014_a_0093: Station_1 NA: PS-CAL: Rusty grate: Clean and repaint (M)

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System Inspection Report Little Cal - Munster (LCMN)

Pump Stations
Page 5 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

Rated Item	Rating	Rating Guidelines		Location/Remarks/Recommendations
(Equipment, Ladders, Platform Anchors, etc)		M	Corrosion seen on metallic parts appears to be maintainable.	LCMN_2014_a_0094: Station_1 NA: PS-CAL: Rusted floor cover: Repaint (M)
		U	Metallic parts are severely corroded and require replacement to prevent failure, equipment damage, or safety issues.	
		N/A	There are no other significant metallic items.	

¹ Proper operation of this item must be demonstrated during the inspection.

² Check motor control center, circuit breakers, pilot lights, volt meters, ammeters, sump level indicator, gate position indicators, remote operating systems, including SCADA and telemetry systems. Also, check interior and exterior lighting; especially lighting near trash rack screens, ladders, walkways, etc.

³ Proper operation of the gates (full open and closed) must be demonstrated during the inspection if no documentation is available. Be aware of both manual and electrical operators.

Key: A = Acceptable. M = Minimally Acceptable; Maintenance is required. U = Unacceptable. N/A = Not Applicable. FDR = Flood Damage Reduction





US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 6 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

	<p>Inspect ID: LCMN_2014_a_0075 Title: USACE_CELRC_LCMN_2014_a_0075_1.jpg Rated Item: 3. Safety Compliance Caption: Rating: Minimally Acceptable; Remarks: PS-OA: Non-standard exit sign; Action: Replace with compliant signage</p>
	<p>Inspect ID: LCMN_2014_a_0081 Title: USACE_CELRC_LCMN_2014_a_0081_1.jpg Rated Item: 3. Safety Compliance Caption: Rating: Minimally Acceptable; Remarks: PS-OA: MCC and pump control cabinet must be posted with proper Arc-Flash warning sign per latest NFPA 70 and NFPA70E; Action: Post Arc-Flash warning signs</p>



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 7 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations



Inspect ID: LCMN_2014_a_0085 **Title:** USACE_CELRC_LCMN_2014_a_0085_1.jpg
Rated Item: 3. Safety Compliance **Caption:** Rating: Minimally Acceptable; Remarks:
PS-BA: MCC and pump control cabinet must be posted with proper Arc-Flash warning
sign per latest NFPA 70 and NFPA70E
; Action: Post Arc-Flash warning signs;
;



Inspect ID: LCMN_2014_a_0092 **Title:** USACE_CELRC_LCMN_2014_a_0092_1.jpg
Rated Item: 3. Safety Compliance **Caption:** Rating: Minimally Acceptable; Remarks:
PS-CAL: MCC and pump control cabinet must be posted with proper Arc-Flash warning
sign per latest NFPA 70 and NFPA70E; Action: Post Arc-Flash warning signs





US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 8 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

 A photograph showing a white pipe with a section of its insulation missing, revealing the metal pipe. The pipe is mounted on a light-colored, possibly concrete or masonry, wall. A blue horizontal pipe runs across the lower part of the frame. A red timestamp "30/4/2014 9:38" is visible in the bottom right corner of the photo.	<p>Inspect ID: LCMN_2014_a_0076 Title: USACE_CELRC_LCMN_2014_a_0076_1.jpg Rated Item: 5. Plant Building Caption: Rating: Minimally Acceptable; Remarks: PS-OA: Insulation starting to peel off of pipe in trash rake room and possible water damage to the masonry wall.; Action: Repair insulation, clean wall</p>
 A photograph of a brick wall corner. The bricks are reddish-brown with white mortar. Above a dark window frame, the seal at the lintel is deteriorating and peeling away from the brick. A red timestamp "30/4/2014 9:53" is visible in the bottom right corner of the photo.	<p>Inspect ID: LCMN_2014_a_0077 Title: USACE_CELRC_LCMN_2014_a_0077_1.jpg Rated Item: 5. Plant Building Caption: Rating: Minimally Acceptable; Remarks: PS-OA: Deteriorating seal at lintel ; Action: Seal; ;</p>



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 9 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations



Inspect ID: LCMN_2014_a_0084 **Title:** USACE_CELRC_LCMN_2014_a_0084_1.jpg
Rated Item: 5. Plant Building **Caption:** Rating: Minimally Acceptable; Remarks: PS-BA: Exposed rebar in concrete; Action: Patch



Inspect ID: LCMN_2014_a_0086 **Title:** USACE_CELRC_LCMN_2014_a_0086_1.jpg
Rated Item: 5. Plant Building **Caption:** Rating: Minimally Acceptable; Remarks: PS-CAL: Broken concrete and leaking at skylights; Action: Seal cracks





US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 10 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

	<p>Inspect ID: LCMN_2014_a_0087 Title: USACE_CELRC_LCMN_2014_a_0087_1.jpg Rated Item: 5. Plant Building Caption: Rating: Minimally Acceptable; Remarks: PS-CAL: Exposed rebar; Action: Patch concrete</p>
	<p>Inspect ID: LCMN_2014_a_0088 Title: USACE_CELRC_LCMN_2014_a_0088_1.jpg Rated Item: 5. Plant Building Caption: Rating: Minimally Acceptable; Remarks: PS-CAL: Spalling in foundation slab; Action: Patch</p>




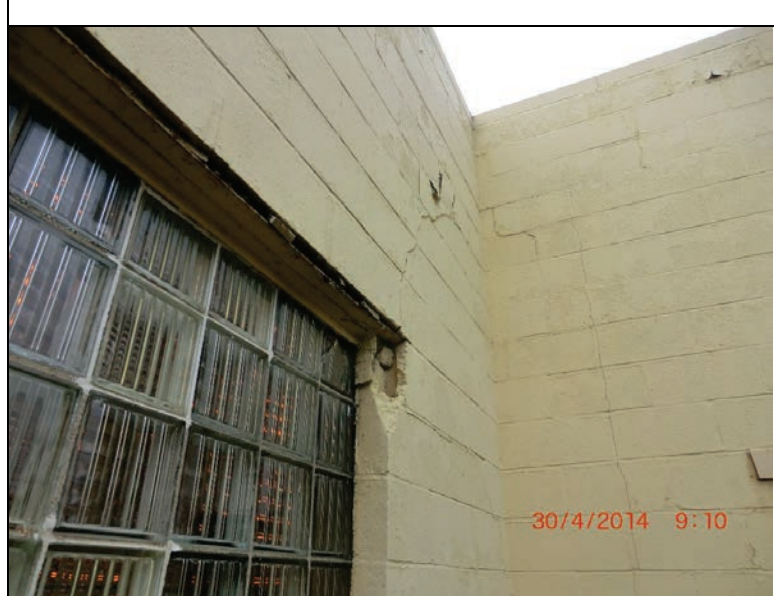
US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 11 of 19

Pump Stations



For use during Initial and Continuing Eligibility Inspections of pump stations

 <p>30/4/2014 9:10</p>	<p>Inspect ID: LCMN_2014_a_0095 Title: USACE_CELRC_LCMN_2014_a_0095_1.jpg Rated Item: 5. Plant Building Caption: Rating: Minimally Acceptable; Remarks: PS-HM: Deteriorating lintel; Action: Fix</p>
 <p>30/4/2014 9:10</p>	<p>Inspect ID: LCMN_2014_a_0096 Title: USACE_CELRC_LCMN_2014_a_0096_1.jpg Rated Item: 5. Plant Building Caption: Rating: Minimally Acceptable; Remarks: PS-HM: Broken masonry at south window; Action: Fix masonry</p>



Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

	<p>Inspect ID: LCMN_2014_a_0097 Title: USACE_CELRC_LCMN_2014_a_0097_1.jpg Rated Item: 5. Plant Building Caption: Rating: Minimally Acceptable; Remarks: PS-HM: Masonry under vent deteriorating; Action: Repair</p>
	<p>Inspect ID: LCMN_2014_a_0098 Title: USACE_CELRC_LCMN_2014_a_0098_1.jpg Rated Item: 5. Plant Building Caption: Rating: Minimally Acceptable; Remarks: PS-HM: Cracking of masonry wall; Action: Seal</p>



Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations



Inspect ID: LCMN_2014_a_0099 **Title:** USACE_CELRC_LCMN_2014_a_0099_1.jpg
Rated Item: 5. Plant Building **Caption:** Rating: Minimally Acceptable; Remarks: PS-HM: Cracking of masonry wall; Action: Seal



Inspect ID: LCMN_2014_a_0078 **Title:** USACE_CELRC_LCMN_2014_a_0078_1.jpg
Rated Item: 6. Fencing and Gates **Caption:** Rating: Minimally Acceptable; Remarks: PS-OA: Damaged fence; Action: Repair




US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 14 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

	<p>Inspect ID: LCMN_2014_a_0079 Title: USACE_CELRC_LCMN_2014_a_0079_1.jpg Rated Item: 6. Fencing and Gates Caption: Rating: Minimally Acceptable; Remarks: PS-OA: Coating peeling; Action: Reapply coat</p>
	<p>Inspect ID: LCMN_2014_a_0080 Title: USACE_CELRC_LCMN_2014_a_0080_1.jpg Rated Item: 6. Fencing and Gates Caption: Rating: Minimally Acceptable; Remarks: PS-OA: Damaged fence; Action: Repair</p>



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 15 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations



Inspect ID: LCMN_2014_a_0089 **Title:** USACE_CELRC_LCMN_2014_a_0089_1.jpg
Rated Item: 6. Fencing and Gates **Caption:** Rating: Acceptable; Remarks: PS-CAL: Rusted fencing; Action: Clean



Inspect ID: LCMN_2014_a_0090 **Title:** USACE_CELRC_LCMN_2014_a_0090_1.jpg
Rated Item: 6. Fencing and Gates **Caption:** Rating: Minimally Acceptable; Remarks: PS-CAL: Damaged fence; Action: Repair



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 16 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations



Inspect ID: LCMN_2014_a_0091 **Title:** USACE_CELRC_LCMN_2014_a_0091_1.jpg

Rated Item: 10. Mechanical Operating Trash Rakes **Caption:** Rating: Minimally Acceptable; Remarks: PS-CAL: Corroding trash rake; Action: Clean and paint



Inspect ID: LCMN_2014_a_0082 **Title:** USACE_CELRC_LCMN_2014_a_0082_1.jpg

Rated Item: 16. Enclosures, Panels, Conduit and Ducts **Caption:** Rating: Minimally Acceptable; Remarks: PS-OA: Exterior duplex receptacle is broken; Action: Replace



US Army Corps
of Engineers®

Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 17 of 19

Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations

	<p>Inspect ID: LCMN_2014_a_0083 Title: USACE_CELRC_LCMN_2014_a_0083_1.jpg Rated Item: 16. Enclosures, Panels, Conduit and Ducts Caption: Rating: Minimally Acceptable; Remarks: PS-OA: Paint peeling; Action: Repaint</p>
	<p>Inspect ID: LCMN_2014_a_0100 Title: USACE_CELRC_LCMN_2014_a_0100_1.jpg Rated Item: 16. Enclosures, Panels, Conduit and Ducts Caption: Rating: Minimally Acceptable; Remarks: PS-HM: Corroded conduit exiting the wall and laying on the ground; Action: Repair</p>



Pump Stations

For use during Initial and Continuing Eligibility Inspections of pump stations



Inspect ID: LCMN_2014_a_0093 **Title:** USACE_CELRC_LCMN_2014_a_0093_1.jpg
Rated Item: 21. Other Metallic Items (Equipment, Ladders, Platform Anchors, etc)
Caption: Rating: Minimally Acceptable; Remarks: PS-CAL: Rusted grate; Action: Clean and repaint



Inspect ID: LCMN_2014_a_0094 **Title:** USACE_CELRC_LCMN_2014_a_0094_1.jpg
Rated Item: 21. Other Metallic Items (Equipment, Ladders, Platform Anchors, etc)
Caption: Rating: Minimally Acceptable; Remarks: PS-CAL: Rusted floor cover; Action: Repaint



US Army Corps
of Engineers®


Flood Damage Reduction Segment / System
Inspection Report
Little Cal - Munster (LCMN)

Pump Stations
Page 19 of 19



Little Calumet River - Munster

U.S. Army Corps
of Engineers
Chicago District

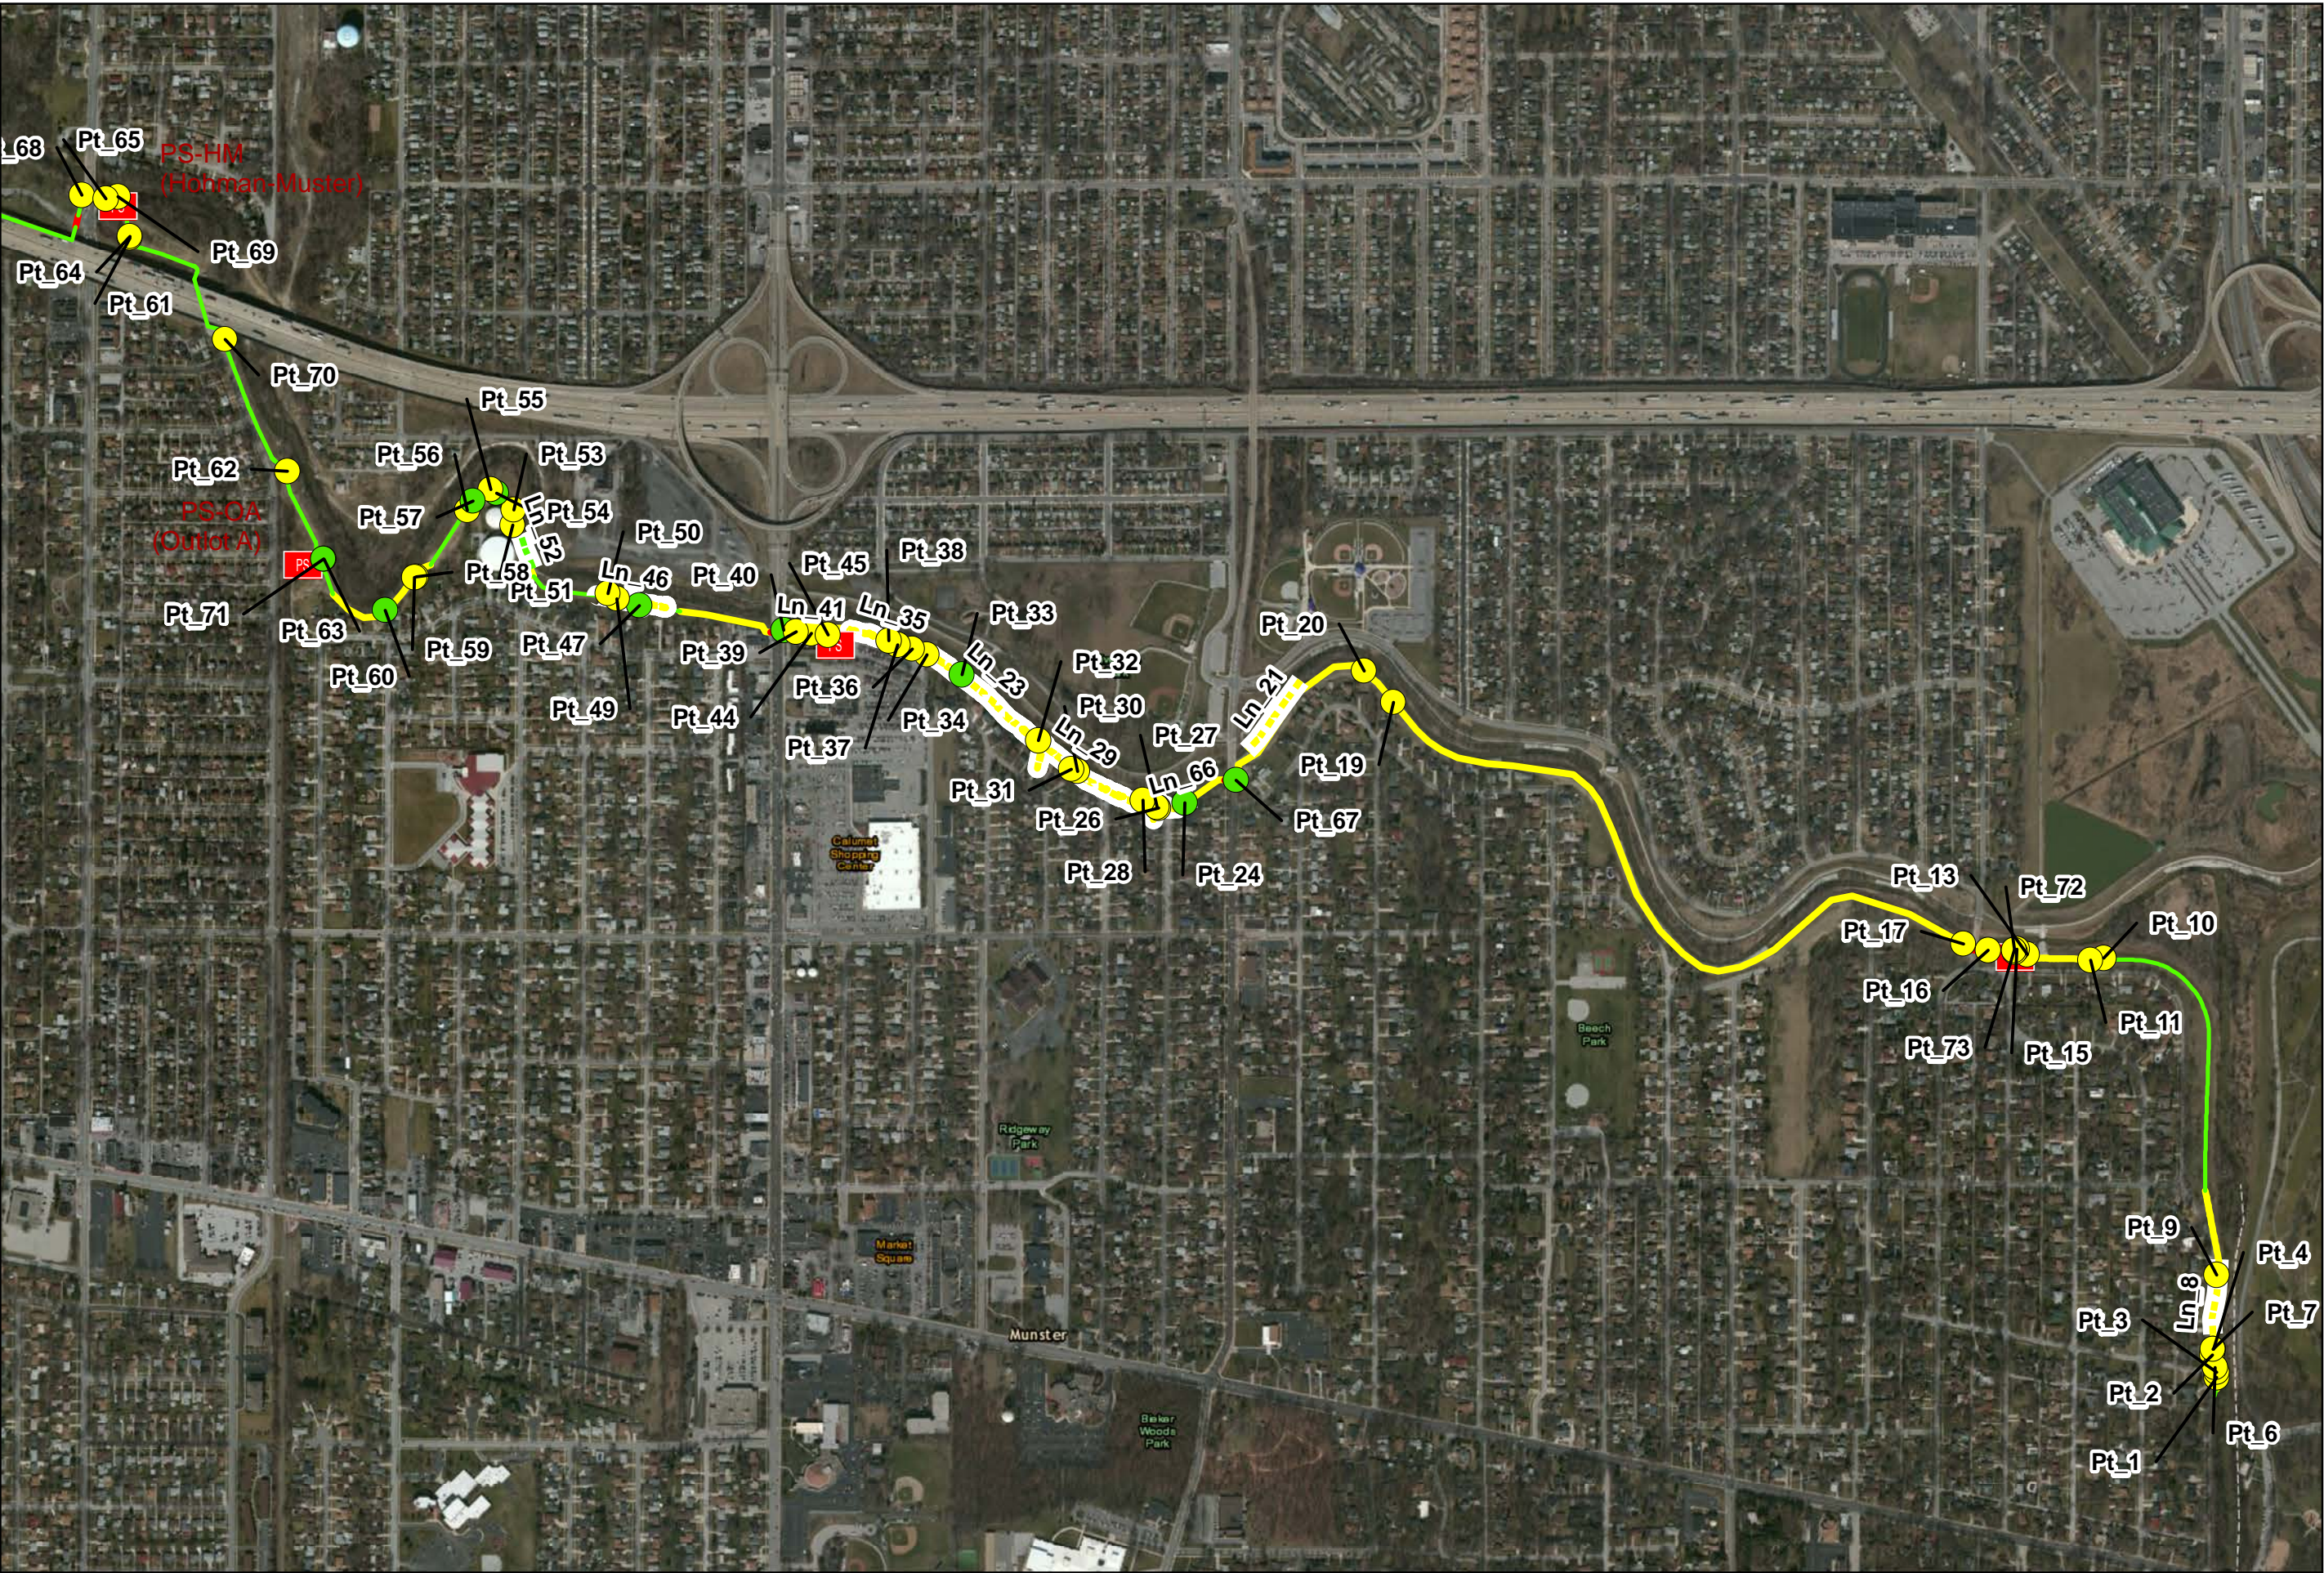

Legend


- A M U Inspection Point
- A
- M Inspection Line
- U
- Floodwall
- Levee
- Closure
- PS Pump Station



0 250 500 1,000 Ft

DISCLAIMER - While the United States Army Corps of Engineers, (hereinafter referred to as USACE) has made a reasonable effort to ensure the accuracy of the maps and associated data, it should be explicitly noted that USACE makes no warranty, representation or guaranty, either express or implied, as to the content, sequence, accuracy, timeliness or completeness of any of the data provided herein. The USACE, its officers, agents, employees, or servants shall assume no liability for any errors, omissions, or inaccuracies in the information provided regardless of how caused. The USACE, its officers, agents, employees or servants shall assume no liability for any damage or injury to persons or property, or any loss of any kind, arising from the use of the maps and associated data in reliance upon any information or data furnished here. By using these maps and associated data the user does so entirely at their own risk and explicitly acknowledges that he/she is aware of and agrees to be bound by this disclaimer and agrees not to present any claim or demand of any nature against the USACE, its officers, agents, employees or servants in any forum whatsoever for any damages of any nature whatsoever that may result from or may be caused in any way by the use of the maps and associated data.

Location Map

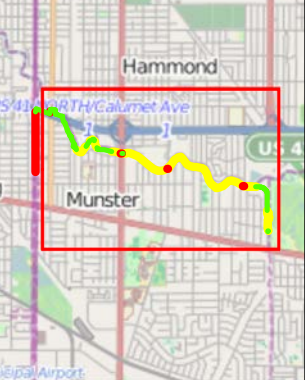


Routine Inspection

July 8, 2014
Overview
Pump Station
Items Not Shown
Plate 1/1



Little Calumet River - Munster

U.S. Army Corps
of Engineers
Chicago District

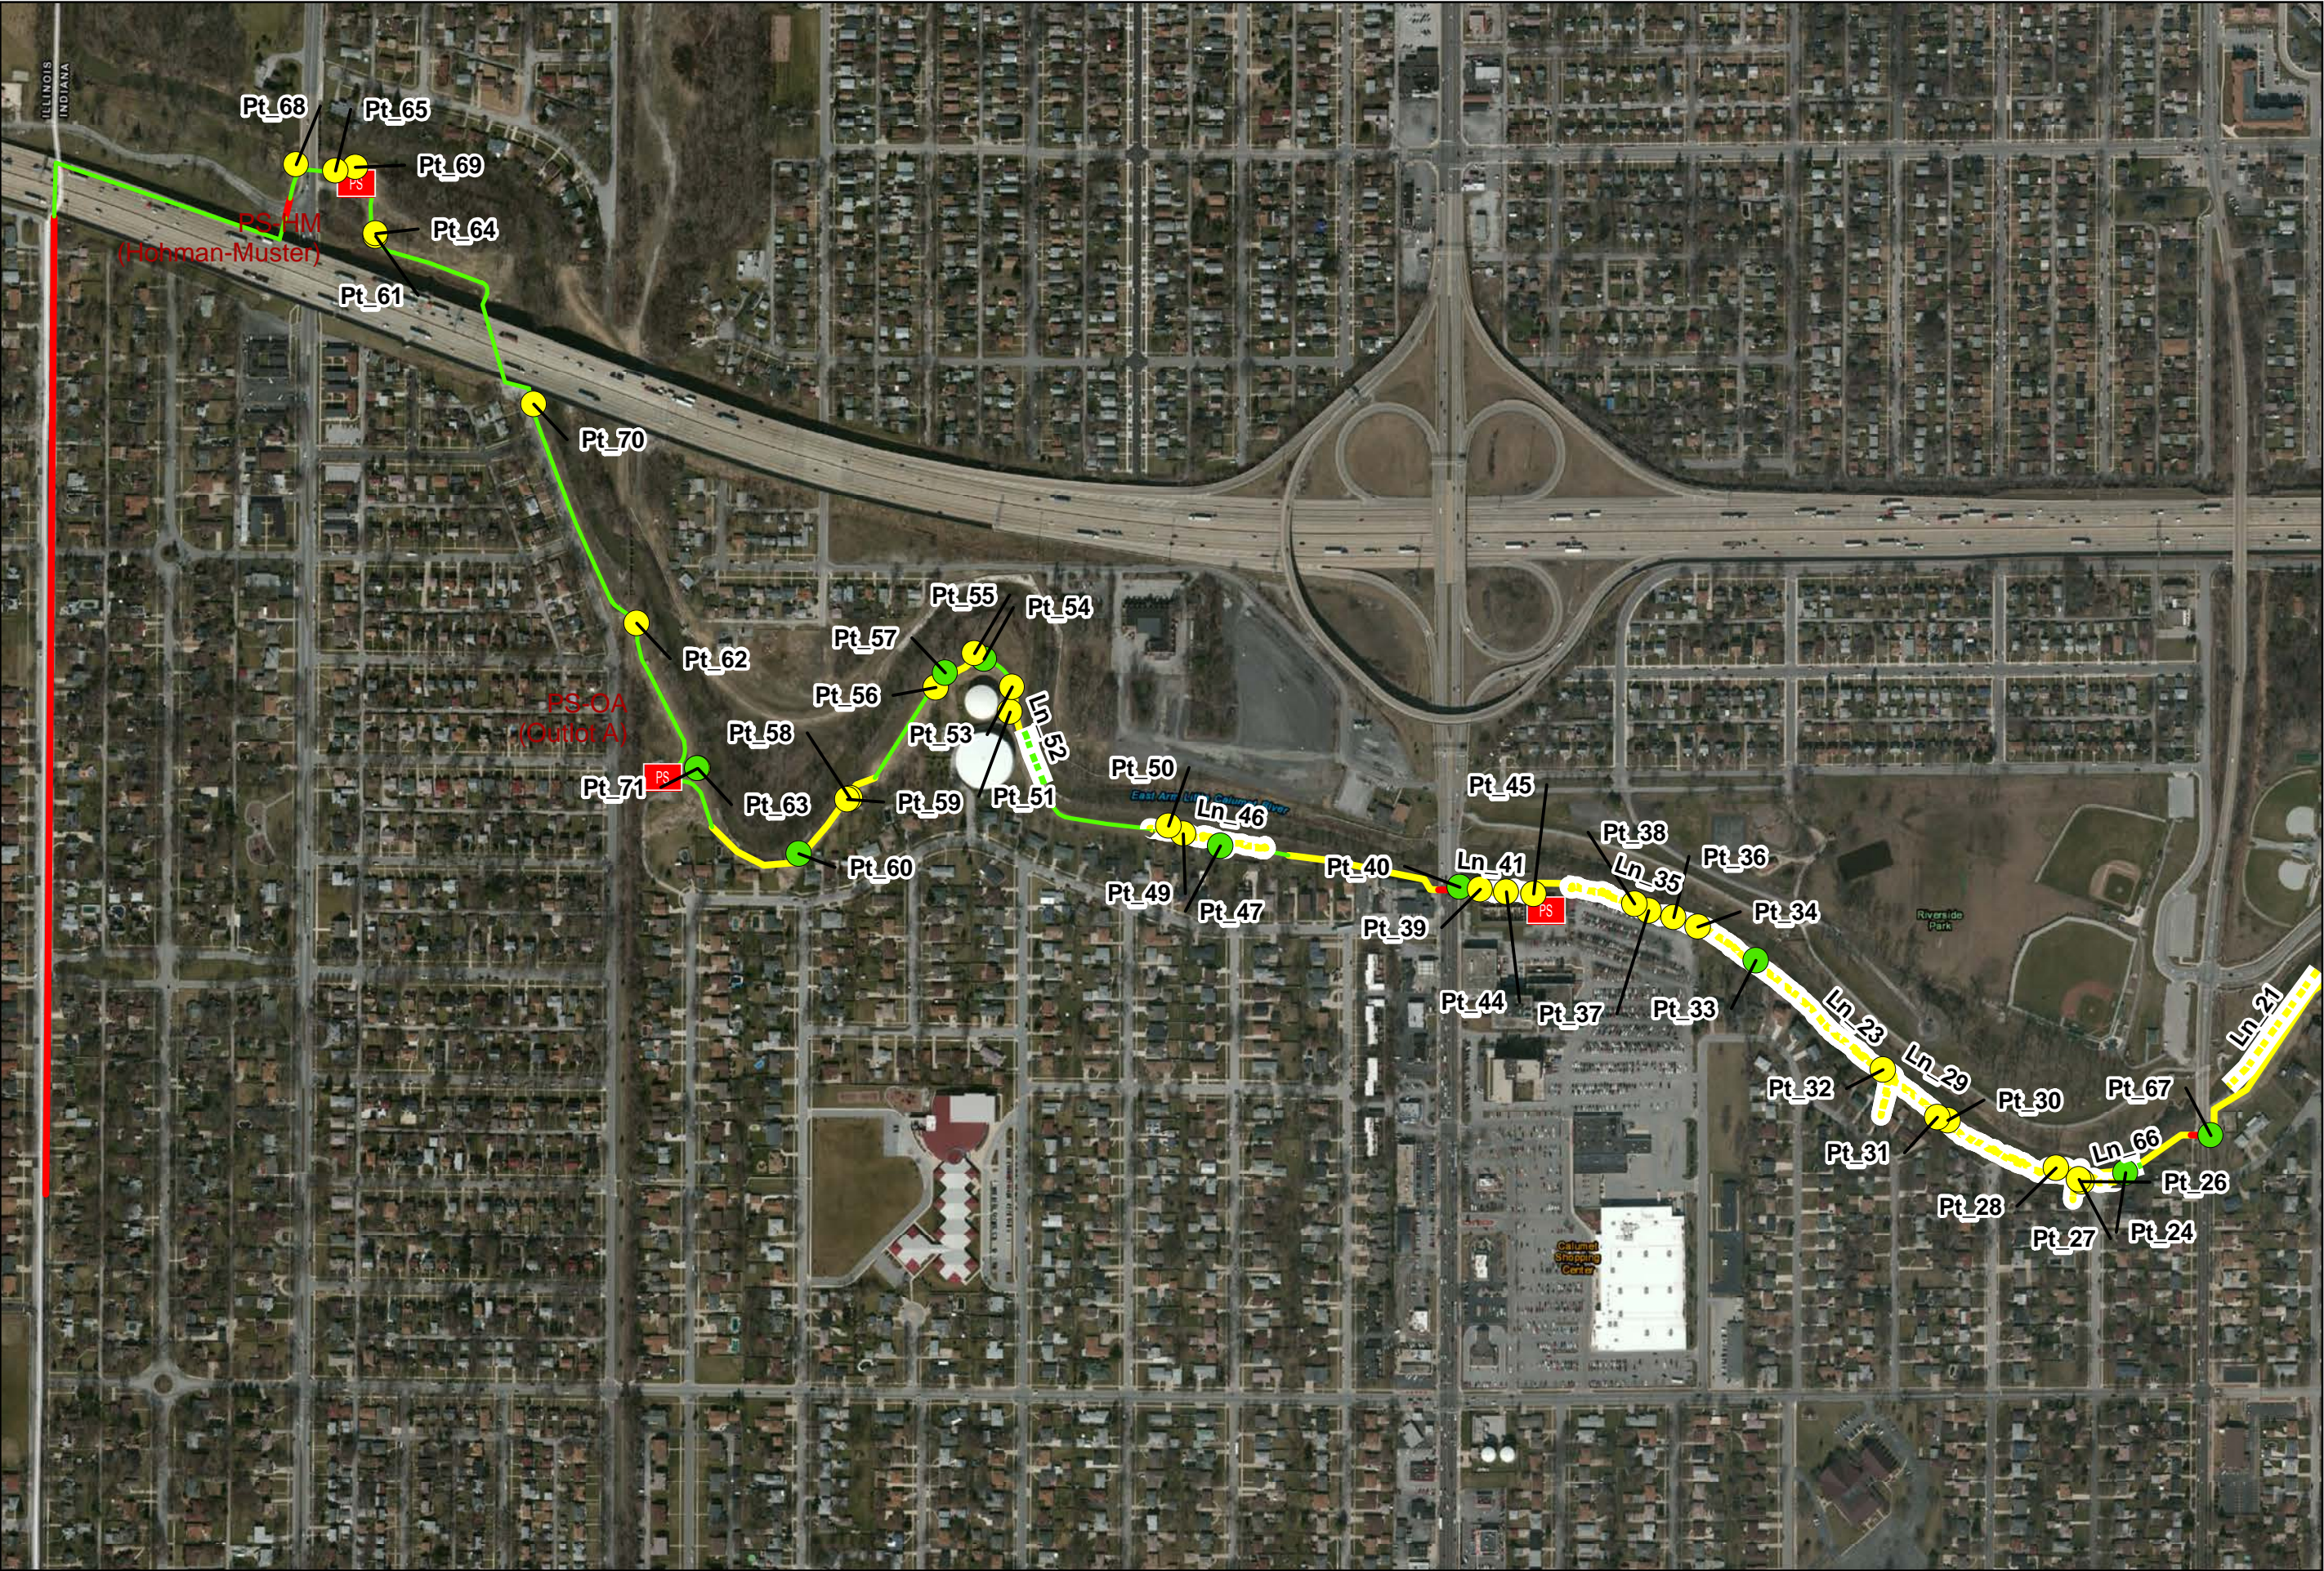

Legend

A M U Inspection Point

--- A

--- M Inspection Line

--- U

Floodwall

Levee

Closure


PS Pump Station



0 155 310 620 Ft

DISCLAIMER - While the United States Army Corps of Engineers, (hereinafter referred to as USACE) has made a reasonable effort to ensure the accuracy of the maps and associated data, it should be explicitly noted that USACE makes no warranty, representation or guaranty, either express or implied, as to the content, sequence, accuracy, timeliness or completeness of any of the data provided herein. The USACE, its officers, agents, employees, or servants shall assume no liability for any nature for any errors, omissions, or inaccuracies in the information provided regardless of how caused. The USACE, its officers, agents, employees or servants shall assume no liability for any nature for any errors, omissions, or inaccuracies in the information provided regardless of how caused. The USACE, its officers, agents, employees or servants shall assume no liability for any nature for any errors, omissions, or inaccuracies in the information provided regardless of how caused. By using these maps and associated data the user does so entirely at their own risk and explicitly acknowledges that he/she is aware of and agrees to be bound by this disclaimer and agrees not to present any claim or demand of any nature against the USACE, its officers, agents, employees or servants in any forum whatsoever for any damages of any nature whatsoever that may result from or may be caused in any way by the use of the maps and associated data.

Location Map

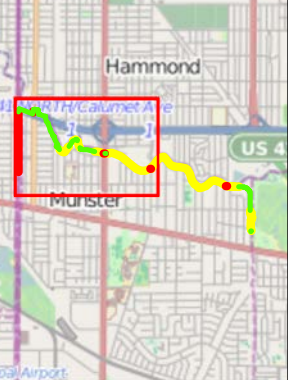

Routine Inspection

July 8, 2014

Overview

Pump Station


Items Not Shown

Plate 1/2



Little Calumet River - Munster

U.S. Army Corps
of Engineers
Chicago District

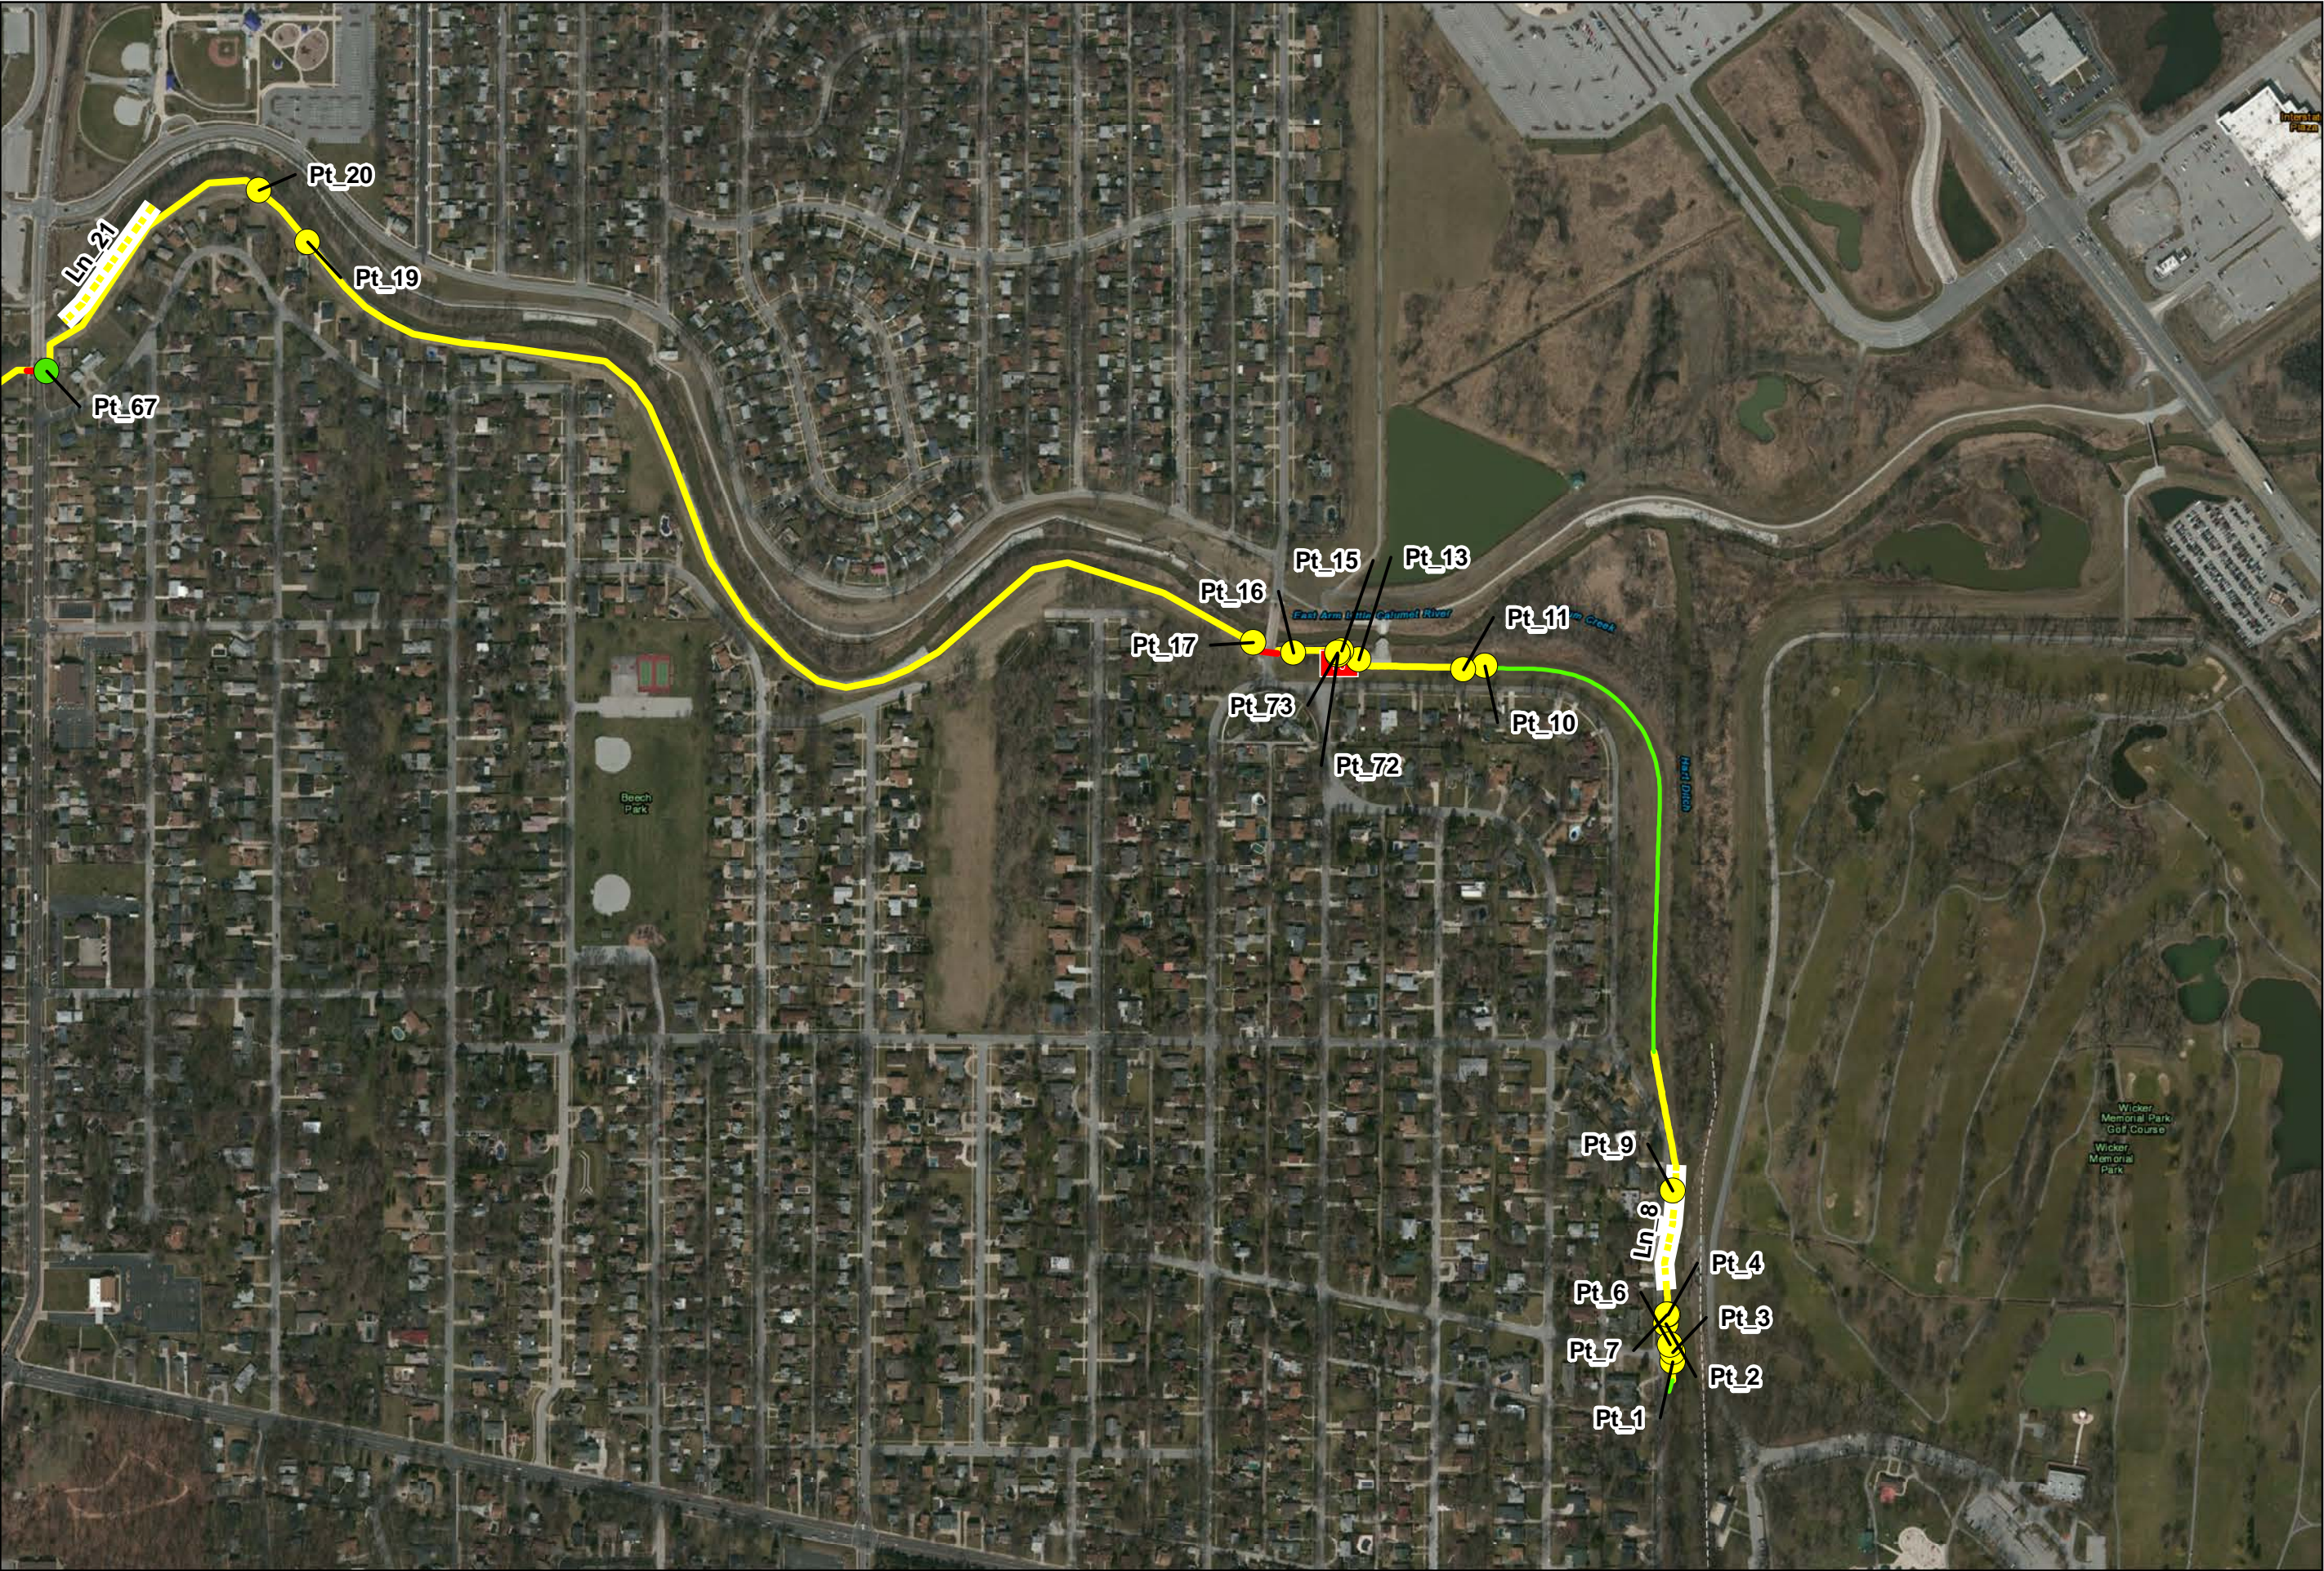

Legend


- A M U Inspection Point
- A
- M Inspection Line
- U
- Floodwall
- Levee
- Closure
- PS Pump Station



0 155 310 620 Ft

DISCLAIMER - While the United States Army Corps of Engineers, (hereinafter referred to as USACE) has made a reasonable effort to ensure the accuracy of the maps and associated data, its should be explicitly noted that USACE makes no warranty, representation or guaranty, either express or implied, as to the content, sequence, accuracy, timeliness or completeness of any of the data provided herein. The USACE, its officers, agents, employees, or servants shall assume no liability for any errors, omissions, or inaccuracies in the information provided regardless of how caused. The USACE, its officers, agents, employees or servants shall assume no liability for any damage for any errors, omissions, or inaccuracies in the information provided regardless of how caused. The USACE, its officers, agents, employees or servants shall assume no liability for any damage for any errors, omissions, or inaccuracies in the information provided regardless of how caused. By using these maps and associated data the user does so entirely at their own risk and explicitly acknowledges that he/she is aware of and agrees to be bound by this disclaimer and agrees not to present any claim or demand of any nature against the USACE, its officers, agents, employees or servants in any forum whatsoever for any damages of any nature whatsoever that may result from or may be caused in any way by the use of the maps and associated data.

Location Map

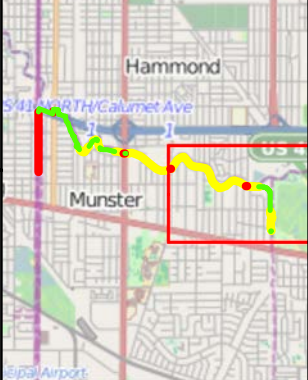

Routine Inspection

July 8, 2014

Overview

Pump Station

Items Not Shown

Plate 2/2

Enclosure 3: Subset of Inspection Items for Rehabilitation Program Eligibility Determination

In order to be eligible, all of the following items must be rated A, M, N/A or Yes.

Note: Item numbers listed below refer to their placement in the Inspection Checklist (Enclosure 2).

Rehabilitation Program Eligibility Determination		
Yes <input checked="" type="checkbox"/>	No <input type="checkbox"/>	Public sponsor provided maintenance information per the Public Sponsor Pre-Inspection Form.
Yes <input type="checkbox"/>	No <input type="checkbox"/>	Non-federal levee system meets Initial Eligibility criteria.
N/A <input checked="" type="checkbox"/>		
If either of the above items is marked "No" the levee system is not eligible.		
Rating	Rated Item	
Levee Embankments		
A <input type="checkbox"/>	M <input checked="" type="checkbox"/>	U <input type="checkbox"/> 3. Encroachments
A <input checked="" type="checkbox"/>	U <input type="checkbox"/>	N/A <input type="checkbox"/> 4. Closure Structures (Stop Log, Earthen Closures, Gates, or Sandbag Closures)
A <input checked="" type="checkbox"/>	M <input type="checkbox"/>	U <input type="checkbox"/> 5. Slope Stability
A <input checked="" type="checkbox"/>	M <input type="checkbox"/>	U <input type="checkbox"/> 6. Erosion/ Bank Caving
A <input type="checkbox"/>	M <input checked="" type="checkbox"/>	U <input type="checkbox"/> 10. Animal Control
A <input checked="" type="checkbox"/>	M <input type="checkbox"/>	U <input type="checkbox"/> 11. Culverts/Discharge Pipes (This item includes both concrete and corrugated metal pipes.)
N/A <input type="checkbox"/>		
A <input type="checkbox"/>	M <input type="checkbox"/>	U <input type="checkbox"/> 14. Underseepage Relief Wells/Toe Drainage Systems
N/A <input checked="" type="checkbox"/>		
Floodwalls		
A <input checked="" type="checkbox"/>	M <input type="checkbox"/>	U <input type="checkbox"/> 2. Encroachments
A <input checked="" type="checkbox"/>	U <input type="checkbox"/>	N/A <input type="checkbox"/> 3. Closure Structures (Stop Log Closures and Gates)
A <input checked="" type="checkbox"/>	M <input type="checkbox"/>	U <input type="checkbox"/> 5. Tilting, Sliding, or Settlement of Concrete Structures

A	<input type="checkbox"/>	6. Foundation of Concrete Structures
M	<input checked="" type="checkbox"/>	
U	<input type="checkbox"/>	
A	<input type="checkbox"/>	8. Underseepage Relief Wells/Toe Drainage Systems
M	<input type="checkbox"/>	
U	<input type="checkbox"/>	
N/A	<input checked="" type="checkbox"/>	
Interior Drainage System		
A	<input checked="" type="checkbox"/>	9. Culverts/Discharge Pipes
M	<input type="checkbox"/>	
U	<input type="checkbox"/>	
N/A	<input type="checkbox"/>	
A	<input type="checkbox"/>	10. Sluice/Slide Gates
M	<input checked="" type="checkbox"/>	
U	<input type="checkbox"/>	
N/A	<input type="checkbox"/>	
A	<input checked="" type="checkbox"/>	11. Flap Gates/Flap Valves/Pinch Valves
M	<input type="checkbox"/>	
U	<input type="checkbox"/>	
N/A	<input type="checkbox"/>	
Pump Stations		
A	<input checked="" type="checkbox"/>	17. Intake and Discharge Pipelines
M	<input type="checkbox"/>	
U	<input type="checkbox"/>	
A	<input checked="" type="checkbox"/>	18. Sluice/Slide Gates
M	<input type="checkbox"/>	
U	<input type="checkbox"/>	
N/A	<input type="checkbox"/>	
A	<input checked="" type="checkbox"/>	19. Flap Gates/Flap Valves/Pinch Valves
M	<input type="checkbox"/>	
U	<input type="checkbox"/>	
N/A	<input type="checkbox"/>	
Rehabilitation Program Status		
Active	<input checked="" type="checkbox"/>	System meets all interim eligibility criteria, including having received a rating of A, M, N/A or Yes for all subset items and is therefore eligible for rehabilitation assistance.
Inactive	<input type="checkbox"/>	System does not meet interim eligibility requirements.
Comments:		